

MUN 8 AUG 1898

No. 304

REPORT of SURVEY for REPAIRS, &c.

Date of writing Report.

IN When handed in at Local Office

6th Aug 1898 Port of ManchesterNo. in
Reg. Book.Survey held at
on the Wood, Iron or Steel.

S/S

Date, First Survey 2nd Aug 1898 Last Survey 4th Aug 1898

No. of Visits

2

W. Kerr

YEAR

MONTH

TONNAGE:

GROSS 3708

UNDER DECK 3335

NET 2355

Built at Newcastle

Owners European Petroleum Co (Ld)

Port belonging to London

By whom W. G. Armstrong, Mitchell & Son

1893-2

Name of Dock Manchester

Causal

Name of Dock Manchester

Causal

Name of Dock Manchester

Causal

WB=Cell DB or Dba

total capacity

feet, uE&B

tons. FPT

feet,

tons; I.P.T.

feet;

tons; MT

feet

tons.

Particulars of Classification (which must be inserted
precisely as in Register Book & Supplements).

Last Report, No. 3

Port Btm

N.B.—All alterations in the existing records should be underlined.
If the vessel has Water Ballast Tanks, state whether the manhole covers have been removed, and the insides of the tanks examined. Also state the amount of deterioration (if any) found in the thicknesses of the floors, framing, girders, and of the inner bottom plating, especially in the boiler space.

CHARACTER.	Date of Special Survey, & of last survey and of Periodical Surveys.	Machinery and Boiler surveys (including date of N.S., if any).
100 A1 Span deck Carrying Petroleum in bulk S.S. Phil. No 1-97	Society's Freeboard (if assigned) as painted on Ship and now verified	6 n. 8 1898

REPAIRS, OR EXAMINATION AS PER RULE, FOR damage stated to have been caused by
collision with S.S. Rock Light

On examination found one bulwark plate doubling
strap & one stanchion & half round beading to bulwark broken
on SW. side in way of No. 5 tank, two sheer strake plates & one
plate in strake below sheer indented & gunwale angle bar bent
The rivets in 6 beam knees on Spar deck & bracket knees to main
deck started & broken, three shell plates & three frames in No. 5
tank indented & one bulwark plate on SW. side in way of
No. 2 & 3 tanks fractured. It has been arranged to fit bolts through the
beam knees & bracket knees and to have permanent repairs effected on
the vessels return in about 6 weeks time, which in my opinion is satisfactory

SUMMARY OF DAMAGE REPAIRS:

Removed
Removed and Fair'd or Repaired
Fair'd or Repaired in place

Plates. Frames. R. Frames. Floors. Beams. Str. Plates. Dk. Plates. Other Items:—

PRESENT CONDITION OF THE

Decks
Caulking of Decks
Waterways
Coamings
Beams & Fastenings
Outside Plating
Caulking of ditto
Rivets
Breasthooks & Crutches
Transoms
Frames
Reverse Frames
Floors
Keelsons

Stringers
Inner Bottom Plating
State if Tanks now tested.

Bulkheads
Ceiling
Cement or Asphalt (state which.)
Rudder
Windlass
Have Pumps now been examined and found efficient.

Have Sluice Valves now been examined and found efficient.

Have Watertight Doors now been examined and found efficient.

Denting. Plates under sounding Pipes.

Engine Room Skylights

Coal Bunkers, Open'gs, Lids, &c.

Scuppers

Cargo Hatchways

Hatches

Planking of Wood Vessels

Treenails ditto

Breasthooks & Stemson ditto

Transoms, Pointers, & Crutches ditto

Timbers of Frame at openings ditto

Ditto ditto another places ditto

Stringers, Clamps & Shells ditto

Salting ditto

Copper, or T.M. ditto

(State if examined.) (State if on Pett.)

When put on Month Year

Boats

Masts, Yards, &c.

Condition, how ascertained

(State if wedges removed)

Sails

Equipment letter

Anchors, No. of

Cables (state if new ranged)

.. length

(on board)

.. Rule length

(per Table 25)

.. size

Hawsers & Warps

Standing & Running Rigging

General Observations, Opinion as to Class, Recommendation, &c.:—

State clearly whether any and, if so, what alteration is suggested to be made in the existing classification and notification of the vessel in the Register Book consequent upon this survey, thus, for example:—"to remain as now classed in the Register Book without fresh record of Survey," "to remain as classed and to have record of survey, 1/2c," or "to remain as classed and to have record of survey, 1/2c, and the notations of No. 1-98 and PIND98, &c."

This vessel, as seen, is in efficient condition, and eligible in my opinion to remain as classed without fresh record, subject to repairs being effected on the vessels return from present intended voyage.

Fee (if chargeable) per Scale II, Sec. 87 £.
Survey Fee (per Section 88) £.
Special Damage or Repair Fee (if any) (per Sec. 88) £.
Travelling Expenses (if chargeable) £.
Second Surveyor's Fee (if any) £.
Committee's Minute
Character assigned Deferred for permanent repair.

Fee applied for,
6/8/1898 F.W.P.
Received by me,
A. J. 8/8/1898
F.W.P.

Surveyor to Lloyd's Register of British & Foreign Shipping.

FRI. 23 SEP 1898