

New York

Decemb-15

5

Shamship, Shathleven

2436

Port Glasgow

1875

1588

Burcell & Sons

Glasgow

38 & 70

Blackwood & Gordon

1875

42"

T - J.

1875

70%

Afloat Pri 45 E.R.

100 A.1

220

6.84.

On examining the Machinery of this Vessel, a crack about 12" long, was found on inside of forward fillet of low pressure crankpin; it disappeared in a hole, drilled about 1/4" deep. A similar crack, about 3" long, was found in after fillet of the same crankpin.

Temporary repairs being requested, a steel pin, 5" dia, was shrunk into ^{the defective crankpin} ~~the defective crankpin~~ at both ends.

It was recommended, to put in a new crankshaft at the first opportunity.

The Boilers of this Vessel were carefully examined inside and outside, and found in good condition. The Safety Valves were examined, found good and set to the working pressure.

Would recommend, that the Machinery Records of this Vessel be continued, until the temporary repairs can be replaced by permanent repairs.

4 2 to Dec. 15 J.H.

John Kay.

LR-FAP-549-36

LR-FAP-549-33

LR-FAP-549-33



© 2018
Lloyd's Register
Foundation