

Received from Chief Ship Surveyor 28 AU

SHIP'S NAME "FLAMMULINA" REPORT Kgn. No.

VC

Outstanding Conditions of Class: SUBJECT to rudder king post (E.W. 7.57 and 5.59) being specially examined next drydocking, to shell plate No.2 in 3rd below sheer in way of hold (s.s.) shell plate E.12 (p.s.f) in way of after pump room and set in shell plates H. 4.5. & 13 J. 4.7. 8 & 14 and K.9.12 & 13 (p.s.f) and H. 2.3.4. & 5 and J. 4 & 5 (s.s.f) and framing in way being permanently repaired by the Special Survey, and to repairs to bottom shell plating in S.R.L. Appendix. (~~As before or~~ None) No.8 centre tank in way of suction strum being specially examined and dealt with as nec. by S.S.

Nature of Present Survey: (Afloat ~~and in dry dock~~)

Temporary repairs on account of shell leakage.

Recommendation: SUBJECT as above, and to shell plating in 'H' strake between frames 79 and 80 (p.s) being specially examined and dealt with as found necessary by the next drydocking.

As now. SUBJECT.



© 2021

Lloyd's Register
Foundation

002602-002610-0262