

COPY

LOYD'S REGISTER OF SHIPPING

UNITED WITH THE BRITISH CORPORATION REGISTER

D.579

Port ALEXANDRIA.

9th FEBRUARY, 1954.

This is to Certify that

R. W. STONEHOUSE,

undersigned Surveyor to this Society did at the request of Messrs. MANLEY & Co. Lloyd's Agents, Alexandria, acting on behalf of Messrs. D.J. Papadimitriou Sons, and with the consent of the Captain, attend on board the Steel Screw Steamer

"BURICA"

1,000 tons gross of Puerto Limon for the purpose of ascertaining the nature and extent of the damage stated to have been caused by the s.s. "ARES" dragging her anchors during strong winds on the starboard side causing the port side fore-castle of the "ARES" to contact the starboard side bridge of the "BURICA" on the 3rd day of February, 1954.

For further details please see ship's log books.

On the 6th February, 1954 and subsequent date, the undersigned made the following examination and

D.

RECOMMENDED.

Starboard side Bridge.

Fore and aft wing cabin side and after end
Box. 4 feet x 4 feet x 7 feet high
Painted.

Bridge cabin, two sides
to renew complete.

Fore and aft tongue and groove planks on fore side
Outboard end smashed.

Two planks to renew.

4" x 4" x 14 ft. long thwartship
Cracked.

One wood beam to renew.

Four square glass windows in cabin
Shattered.

To be renewed.

Starboard side-light, carrier and
Fittings, missing.

Side-light, carrier and fastenings
to be renewed complete.

Electric plug socket for sidelight
Loose, electric lead intact but
Lifted.

Plug socket to be renewed,
electric cable to secure to
new cabin side.

This certificate is issued upon the terms of the Rules and Regulations of the Society, which provide that:—
The Committees of the Society use their best endeavours to ensure that the functions of the Society are properly understood that neither the Society nor any Member of any of its Committees is under any circumstances responsible for any inaccuracy in any report or certificate issued by the Society or its Surveyors, or in any other Book or other publication of the Society, or for any error of judgment, default or negligence of any of any Member thereof, or the Surveyors, or other Officers or Agents of the Society."

00736-00742-0181

Lloyd's Register Foundation

RECOMMENDED.

ing stanchion set over.

To be straightened.

d lifeboat davit bent.

To be removed, faired and replaced.

ndrail stanchions bent.

To straighten.

. 8 feet of outboard flange
edge deck margin channel
nboard.

To be faired in place.

ie plate slightly buckled.

To be faired in place.

sheer strake, 1st plate
forward slightly indented.

To be faired in place.

homs 3" wire rope parted.

60 Fathoms 3" wire rope to be renewed.

also stated three rope
s were lost overboard.

3 rope fenders to be renewed.

recommendations made so as to place the vessel in the same
and efficient condition as before the damage was sustained.


ried cut in Alexandria, it is estimated the above repairs will
approximately LE.190.- at current prevailing prices.

Robert Stonehouse

.....
SURVEYOR TO LLOYD'S REGISTER OF SHIPPING.

15000

1750.

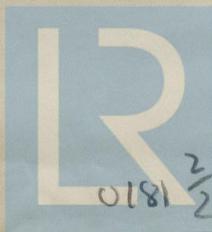

© 2021

Lloyd's Register
Foundation