

REPORT OF SURVEY FOR REPAIRS, &c.

of writing Report... 5. 2. 19 49 When handed in at Local Office... 5. 2. 19 49 Port of BARROW.
o. in Survey held at HEYSHAM Date, First Survey and Last Survey 4th February, 19 49
- Book. element on the Wood, Iron or Steel S.S. "THAUMASTUS" (No. of Visits... One...)

TONNAGE :- Built at PORTLAND, OR. By whom KAISER CO. INC. When 1945 - MONTH.
GROSS 10670 Owners ANGLO-SAXON PETROLEUM CO., LTD. Owners' Address -
DER DK. 9489 Managers - (If not already recorded in Appendix to Register Book).
R 6315 Port belonging to LONDON.

Kept Afloat or in Dry Dock? Afloat. Name of Dock - Destined Voyage -
DBorDBa - feet; uE & B - feet; f - feet
capacity - tons. FPT - tons; APT - tons; MT - feet - tons.

Only alterations in the existing records of tanks should be inserted.
N.B.—All alterations in the existing records should be underlined.

st Report, No. _____ Port _____

ical Surveys, when held, must be reported in detail and serially in the terms of the Rules and items remaining to complete Surveys should be summarised. State clearly the cause of Repairs, if any, and, in detail, the nature and extent of Examinations subsequent repairs. Repairs on account of Damage (the cause of which must be stated) should be separated from Repairs due to r causes; and besides being detailed in the body of the report, should be summarised in the form shown below. Whenever the cement of Anchors or Chains is reported the particulars should be clearly stated in the space provided on the back of this form. Also the dates and initials of any letters respecting this case.

page cases where the Surveyor has not made a special damage report he is required to state whether he offered his services for this purpose and to whom and why they were declined. Not required.

Particulars of Classification (which must be inserted precisely as in Register Book & Supplements)	
CHARACTER.	Machinery and Boiler Surveys (Including date of N.B., if any).
100A1	BS 5,48
5,48	TS. CL 5.48
Classed 5,48	
ss. Gal. - 5,48	
Plc. welded	WTB
Carrying Petroleum in bulk.	
Society's Freeboard (if assigned) as painted on Ship and now verified } - ft. - ins.	

Was a damage report made by anyone else? if so, by whom? -
RS, OR EXAMINATION AS PER RULE, FOR DAMAGE. ISSUE OF INTERIM CERTIFICATE.

ge to bow plating in way of fore peak tank stated to have been sustained as a result of vessel grounding during passage of the Suez Canal on the 16th January, 1949.

1. The stem fore foot plate was badly set in and the plating cracked.
A temporary repair had been carried out at Port Said by wedging the cracked plating and filling the first three bays of floors in fore peak solid with cement. On examination this temporary repair is considered efficient and an Interim Certificate (copy attached) has been issued.

OF DAMAGE REPAIRS :-	Shell Plates.	Frames.	R. Frames.	Floors and Bracket Floors	Beams.	Inner Bottom Plates.	Dk. Plates.	Other Items :-
ved								
ved and Faird or Repaired								
or Repaired in place ...								

CONDITION OF THE	Bulkheads	Engine Room Skylights	Copper, or Y.M.
Decks	Ceiling	Coal Bunkers, Openings, Covers, &c.	(State if on Felt.)
tenings	Cement or Asphalt	Oil Bunkers	When fitted, Month Year
g	Rudder	Scuppers	Boats
in way of sidelights	Steering gear and its connections	Cargo Hatchways	Masts, Yards, &c.
s	Windlass	Hatches	Condition, how ascertained
Plating	Have pumps been examined and found efficient?	Planking	(State if wedges removed.)
been examined internally?	Have Sluice Valves been examined and found efficient?	Caulking	Equipment letter
been tested?	Have Watertight Doors been examined and found efficient?	Treenails	Anchors, No. of
	Have Ventilators and their Coamings been examined and found efficient?	Breasthooks & Stemson	Cables (State if now ranged)
	Air and Sounding Pipes	Transoms, Pointers & Crutches	" length mean diamr.
	Doubling Plates under Sounding Pipes	Timbers of Frame at openings	(on board.)
		" " at other places	" Rule length size.
		Stringers, Clamps & Shelves	Chain Locker
		Salting	Hawsers & Warps.
		State if examined.	Standing and Running Rigging
			Sails

Observations, Opinion as to Class, Recommendation, &c. :—
ate clearly whether any and, if so, what alteration is suggested to be made in the existing classification and notification of the vessel in the Register Book consequent upon y, thus, for example :—"to remain as classed in the Register Book without fresh record of Survey," "to remain as classed and to have record of 38," or "to remain as classed and to have record of survey, 1,38, and the notations of ss No. 1-38."
vessel, so far as now seen, is in an efficient condition and eligible, in my opinion, in as Classed without fresh Record of Survey, subject to permanent repairs being carried the end of March 1949, at which time the vessel is being dry docked. (Supply 30 fathoms first opportunity).

ection 29) £ 7 : 7 : 0 Fees applied for, 5.2. 19 49
Repair Fee (if any) £ : : Received by me, 19
(if chargeable) £ 1 : 15 : 8
ee (if any) £ : :
Minute. 18 FEB 1949
signed. Defended for dry dock

H.P. Urwin
Surveyor to Lloyd's Register of Shipping.