

MO TO SHIP REPORTS

"DONACILLA"

(Tanker, 20 years old)

An examination of the shell and deck drillings forwarded with
Kong Report No. 15036 indicates that renewals of shell and
per deck plating will be necessary at the next Special Survey.
However no drillings other than the belt drillings have been
forwarded and it is not possible to give a detailed estimate of
renewals except in way of the belts reported. These are as follows:-

CK

. 42	Port	1st strake inboard of stringer. Centreline strake.
. 117	Stbd. Port	1st and 3rd strakes inboard of stringer 1st strake inboard of stringer.

ELL

. 42	Bottom	Port	B and C
		Stbd	B
	Side	Port	J
		Port and Stbd	H
. 90	Side	Stbd	K
		Stbd	J
		Port	H
. 117	Bottom	Stbd	D
	Side	Port	H and J
. 154	Bottom	Port and Stbd	A and B
	Side	Stbd	G and K
		Port	F

The Surveyors at the Special Survey will however require to
verify that these drillings represent the general condition of
the ship and further renewals due to deterioration may be required.

OKR *OKB*

7th December, 1959.

[Signature]



© 2020

Lloyd's Register
Foundation

003046-003055-0327