

4E

10 MAY 1960

f Engineer Surveyor.....

Received from Chief Engineer Surveyor.....

4E.....MAHOON.....REPORT.....Drb.....No. 8764.....

The Surveyor reports some damage repairs effected the main engine attached air pump and in addition to other damage, the bottom lugs securing the pump casting to the main engine columns were found fractured, the fractured lugs veed and welded and a heavy mild steel band fitted round the pump casting and bolted to columns. Also two mild steel lugs fitted. Upon completion of repairs, the main engine tested, and the repairs found to be satisfactory, but the Surveyor recommends that the class be made subject to repairs air pump being specially examined before the end of June, 1960.

IT IS SUBMITTED this vessel is eligible to remain classed, subject as recommended.

Report should be returned to the Surveyor for signature.

X17/5



6.5.60.
© 2020

Lloyd's Register
Foundation

003328-003332-0195