

The class is subject to the vertical donkey boiler not being used; the sanitary injection valve being renewed at the first opportunity and to the machinery spares being completed.

2E

by Chief Engineer Surveyor

Received from Chief Engineer Surveyor

JAN 1949

NAME "LEME"

Rpt.

Nap. No. 4309

Remarks of the Chief Engineer Surveyor are desired on this case for the consideration of the Classing Committee.

("The endorsement to contain a succinct summary of any repairs that have been required and to show the cause or causes of such repairs, and also to bring out clearly any exceptional features in connection with the case, so that the Classing Committee may have all the salient points presented in the endorsement. —Extract from Sub-Committee's Report, 24.5.92.")

Survey ~~-COMPLETION-OF SPECIAL SURVEY OF ENGINES AND BOILERS FOR S.S.-No.-~~

This Survey, due 6.48 <sup>now</sup> ~~partly held at~~ & screw shaft examined, ~~now~~ ~~completed,~~ and the following repairs carried out (due to wear & tear):-

Three main engine liners and pistons renewed. Various repairs effected to the auxiliaries.

Temporary repairs have been effected to the HP cylinder and cooler jackets of the auxiliary compressor.

The windlass cylinder repair may be considered as permanent and the item deleted from the S.R.L.

The crank shaft of the Fiat Auxiliary Engine is twisted and has been annealed. The Surveyor recommends it be renewed at the first opportunity.

The spare gear has been completed.

The vertical donkey boiler was not repaired at this time.

*The sanitary injection has now been renewed.*

The emergency compressor HP cylinder jacket and cooler jacket were found corroded and the Surveyor recommends this be renewed at the first opportunity.

It is submitted the vessel is eligible to remain as classed, with

tation of

\* LMC 11.48,

as recommended.

DBS 11.48,

S 9.48,

Subject to the crank shaft of the Fiat Auxiliary and the HP cylinder and cooler jacket of the auxiliary compressor being renewed at the first opportunity, also to the donkey boiler not being used; without other special conditions.



© 2020

8. 1. 49.

Lloyd's Register  
Foundation

003599-003604-0028