

Rpt. 8

REC'D NEW YORK

APR 1957

Port Curacao N.A.

No. 5094

Date of writing Report 28. 3. 57

When handed in at Local Office

Received London

11 MAY 1957

Survey held at Willemstad, Curacao N.A.

No. of Visits 2

First Date 25. 3. 19 57

Last Date 27. 3. 19 57

## REPORT OF SHIP SURVEYS AND REPAIRS

The Surveyor's attention is drawn to the relevant requirements of Chapters B & C of the Rules.)

No. in R.B.

68331

SS.

"LUCIA"

Tons gross 3217

Year 1943 Month

Built at Philadelphia

By Whom U.S. Navy Yard

When

Owners N.V. Curacaosche Scheepv. Maats.

Owners' address (If not already in R.B.)

Managers - Do -

Port of Registry Willemstad

Surveyed Afloat or in Drydock Afloat

Name of Dock

Date of last examn. in Drydock

N.B. Any alterations in existing particulars in the Register Book should be reported and underlined.

Last Report No. 4989 Port CCO

Particulars of Classification (which must be inserted precisely as in Register Book and Supplement)

Surveys must be reported in the terms of the Rules. The nature and extent of Examinations and Repairs (if any) must be stated in detail, the parts examined and their condition being clearly indicated. For Annual, Special or other Condition Surveys the Summary of Examination and Condition on the back of the Report is to be carefully completed and amplified if necessary in the body of the Report. Outstanding items to complete the Survey should be summarised at the end of the Report. The reasons for Repairs must be stated. Repairs on account of Damage (the alleged cause of which must be stated) should be separated from Repairs due to other causes, and, besides being detailed in the body of the Report, should be summarised in the form below. When, at a Special Survey, the Shell and Deck Plating is drilled the results must be reported on Report 8(Dr). Whenever Anchors or Chain Cables are replaced or retested the necessary particulars are to be given on Report 8(Eq) which is to be attached to this Report.

SHIP'S CLASS		Machinery	
Date of Special and of Drydocking Surveys, etc.			
Al	9,54	LMC	2,53
Classed	2,49	O.G.	
ss.Wmd (M) 2/53- 2 yrs.		P.	9,54
Carrying Petroleum in bulk.		S.	9,51 N

Give dates and references to any letters relating to this Report

In damage cases where the Surveyor has not made a special damage report he should state whether he offered his services for this purpose and to whom and why they were declined. Rpt. Atch.

Freeboard as marked on ship and now verified ft ins

Was a damage report made by anyone else? If so, by whom?

EXAMINATION AND REPAIRS AS PER RULE FOR Damage stated to have been sustained due to contact with "Palmarejo" Dolphin, Lake Maracaibo, Venezuela whilst berthing in ballast condition on 22nd March 1957. Vessel examined afloat.

### FOUND

### RECOMMENDED

Damage confined to bow plating port side:-

1st plate from stem, port side, in 2nd strake below main sheer strake set in and holed over length of approx. 4'0".

To be renewed.

One longitudinal frame buckled over approx. length of 4'0".

To be cropped and part renewed.

One breast hook buckled.

To be renewed.

Now Done:- As a temporary measure a doubling plate, 4'6" x 4'0" x 3/8" welded over holed plate, examined and hose tested upon completion of fitting and found to be satisfactory in the meantime, but it is recommended that the repairs be specially examined or permanently dealt with next Drydocking.

CONTINUATION OVER/OR SHEET 2

SUMMARY OF DAMAGE REPAIRS	Shell Plates	Frames	R. Frames	Floors and Bracket Floors	Inner Bottom Plates	Deck Plates	Beams	Other Items
Renewed								
Removed and Faired or Repaired								
Faired or Repaired in place								

Has a Survey also been held on machinery of the Ship?

Is Classification Certificate required? If so, to be sent to

If so, is the Report sent now, or when will it be sent?

Has Interim Certificate been issued?

### GENERAL OBSERVATIONS, OPINION AND RECOMMENDATION AS TO CLASS

State clearly what alteration, if any, is suggested to be made in the existing Classification or Survey or other records of the Ship in the Register Book consequent upon this survey, for example:- "to remain as Classed in the Register Book without fresh record of Docking"; "to remain as Classed and to have record of drydocking 1,55"; or "to remain as Classed and to have record of drydocking 1,55, and the notation of S.S. . . . 1,55".

This vessel so far as now seen is eligible in my opinion to be retained as now classed without fresh record of survey and subject to 1st plate from stem in 2nd strake below main sheer strake port side being specially examined or permanently dealt with next Drydocking.

W. P. Holmes

Surveyor to Lloyd's Register of Shipping

Date of Commitment

Minute

THURSDAY 17 MAY 1957

As now, subject

30m. 5,50



© 2021

Lloyd's Register Foundation

003838-003848-0038



TABLE 1

PARTS OF THE SHIP AS INDICATED BELOW HAVE BEEN EXAMINED FOR			SURVEY	
Items	Now Examined YES NO or NONE	Tanks	Now Examined Internally	Now Tested
Shell plating, sternframe and rudder cleaned, examined and recoated in drydock		F.P. Tank		
Rudder lifted		A.P. "		
Weather Decks, Superstructures and Casings		D.B. Tanks (indicate Oil Fuel and Cofferdams)		
Hatchways, Covers, closing and securing appliances				
Ventilator coamings, skylights, companionways and closing appliances		Fresh Water Tanks		
Holds		Deep Tanks		
		Oil Fuel Bunkers and Settling Tanks		
'Tween Decks		Side Tanks		
Fore Peak Spaces		Wing Tanks		
After " "		Other Tanks		
Engine Space				
Boiler		Cargo Tanks (Tankers)		
Under Engines and Boilers				
Tunnel and Well		Cofferdams		
Coal Bunkers				
Chain Locker		Pump Rooms		
Other Spaces				
		Have Tanks now Examined been Cleaned as Necessary?		
		Have Strums in Cargo Tanks (of Tankers) been removed?		
		Have Tanks been Retested as necessary after completion of any Repairs?		

Have the spaces now surveyed been cleared and cleaned as necessary?

Have the close ceiling and cargo battens, linings, pipe casings, etc., been removed and replaced as required by the Rules?

Have the bilges been cleaned out and examined?

Has cement in bottom been examined?

Has steelwork had rust removed and afterwards been recoated as necessary?

Were inspection plugs or any insulation removed in insulated spaces for examination of steelwork?

Has a Load Line Survey been held? If so, state which

If so, Report 8(Dr) to be attached

Have the shell and deck plating been drilled as per Rule?

Have any alterations to the approved scantlings and arrangements now been effected?

If so, report details in body of Report.

NOTE:—Indicate which compartments and/or tanks have been examined or tested by giving the identification numbers and inserting the word "Yes", e.g. Holds: Nos. 1, 2 & 3—Yes; or All—Yes.

TABLE 2

The present condition of the following parts in so far as examined is to be reported:—

Shell plating .....	Ceiling and Cargo Battens .....	Sluice Valves examined and found .....
"    "    in way of side scuttles .....	Cement or Asphalt .....	Air and Sounding Pipes .....
Rudder and Sternframe .....	Cargo and other Hatchways .....	Doubling Plates under Sounding Pipes .....
Decks .....	Hatches and closing appliances .....	Masts and Rigging examined and found .....
Superstructures and their closing appliances .....	Ventilators, their coamings .....	Condition, how ascertained .....
Coamings and Casings .....	and closing appliances .....	(State if wedges removed)
Beams and Fastenings .....	Companionways and Skylights .....	Chain Locker .....
Frames.....	Shell Openings .....	EQUIPMENT
Reverse Frames .....	Ash Shoots .....	Equipment Letter .....
Longitudinals .....	Overboard Discharges and Scuppers .....	Anchors, No. of .....
Transverses .....	Freeing ports .....	Condition.....
Floors .....	Steering Gear (Main and Auxiliary) .....	Cables (State if now ranged and examined).....
Keelsons .....	examined and found .....	"    length .....
Stringers .....	Windlass examined and found .....	"    "

Have conditions (A) or endorsements (B) of Class (if any) been dealt with?

See Below

REMARKS, REPAIRS, Etc. (Contd.)

Survey Fee

Special Damage or Repair Fee (if any) £15.150.00

Travelling Expenses (if chargeable) 11 10.00

Second Surveyor's Fee (if any)

Date when A/c. Rendered 28. 3. 57

© 2021

Lloyd's Register Foundation