

is subject to

- 1) Water end valve chest of the after main feed pump being renewed by 1.63 (9 months limit).
- 2) Inboard main feed pump water end being renewed by the end of December 1962 (4 months limit).

Received by Chief Engineer Surveyor.....

Received from Chief Engineer Surveyor.....

SHIP'S NAME..... "SAFINA-E-SAMBOORNIYAT" REPORT..... KRH..... No 3598

LP turbine collar examined after having been partly dressed and a number of surface fractures found on the face of collar.

Completion of repairs to turbine could not be dealt with at this time+stated would be effected on vessel's return to Karachi from present voyage.

SRL item No. 2

Statement made that new pumps had been ordered but delivery was not yet carried out. Existing pumps now examined and some minor repairs carried out and considered efficient meantime. Surveyor further recommends that both centre and inboard main feed pump water ends be renewed by the end of April 1963 (4 months limit).

It is SUBMITTED that this vessel is eligible to remain as classed subject as now amended and recommended for item No. 2 and as above for item No. 1.

SRL-Appendix Note

"L.P. Turbine not in use"

24.12.62

Karachi surveyor should be requested to issue an amended certificate omitting reference to LP turbine not being used until placed in good condition as a subject of class and as in cases such as this, the LP exhaust turbine is not made a condition of class *but* a note entered in the SRL appendix.



© 2021

Lloyd's Register
Foundation

004405-004410-0270