

Ship's name *Indian Endeavour*. Port *Cal*

No. *1414*
20.11.65

Class is subject to *propeller & stem bush fittings being specially examined at next dry docking.*

Docking W/D - 170⁹ rewooded to - 030¹
TS(CL) due 8.66 now held
MBS due 7.66 comm 10.66 now completed
SPS due 15.66 comm 10.66 now advanced.

Repair
Subject item above dealt with, no damage found, Subject to delete.
Stem bush now rewood Sepershaft cone magnafluxed in order.
Tail shaft/int shaft coupling faces watermarked now had dressed & new coupling bolts fitted.
Main injection valve chest & inlet branch to main circ pump found held & wasted. Due to commitments a cement box satisfactory, fitted & it is recommended main injection valve chest (cement box fitted) be specially examined & dealt with as necessary at next dry docking.

It is submitted that this vessel is eligible to remain as CLASSED. MBS 10.64 now TS(CL) 11.64 & SPS 10.64 on completion. Subject only as now recommended.

9/11/65
To complete SPS all Rule requirements except examination of saturated steam pipes in all boiler uptakes to be dealt with.