

COPY

Ship's name

"SALAMMANNA"

Port

CCO

No. 6693.

Last survey date 1/2/63.

Class is subject to:—

- (1) Auxiliary Condenser Water Box being examined at the earliest opportunity.
- (2) Repairs which have been carried out to the Port and Centre Furnaces of the Port Boiler being examined by one of the Society's Exclusive Surveyors at the earliest opportunity.

Docking. Screwshaft examined. Wear down 4.5mm. Keyway at thick end of taper now 'spooned'.

Propeller damage stated due to vessel striking buoy.

One propeller blade tip found bent, now heated and faired, fracture in weld of previously inserted tip now renewed.

SRL: Item (2) now dealt with and the Port Boiler port and centre furnaces repairs found satisfactory. Submitted this item now be deleted.

Item (1) examined and found to continue efficient. A spare water box is on board but not yet fitted. This item to remain as at present noted.

IT IS SUBMITTED that this vessel is eligible for the record TB (CL) 2.63 now, subject as item (1) above but without subject item (2).

*Also eligible for record of MBS. 6.62 now.*



© 2021

Lloyd's Register  
Foundation

004698-004702-0064