

EA

Ship's name "SALAMMANNA"Port

RIO

No.9602Last survey date 25.5.64.

Class is subject to indented shell plate in way of No.4 hold (s.s) and structure in way and to indented sheerstrake and plating in 1st below in way of No.3 hold (s.s), to indented shell plate in 'A' strake in way of No.6 D.B. tank (s.s) and keel plates aft and shell plate in way of No.1 hold bilge (p.s.a) (cement box fitted) being specially examined and dealt with as necessary next drydocking.

S.R.L. Appendix (as before ~~or none~~)Surveys due SPECIAL SURVEY (C) due 4,64.Nature of present survey (~~at sea and~~ in drydock)

Docking: Temporary repairs to damaged bottom shell plating due to grounding.

Is interim certificate in orderYes/No/None
XXXXXXItems outstanding if any for SS

ALL ITEMS.

SS proposed to be completed by

Recommendation SUBJECT as above and to permanent repairs to buckled and set up stem, keel and bottom plating etc. (p. & s) in way of fore peak, Nos.1 & 2 D.B.tanks being specially examined and dealt with as necessary on completion of present voyage to the U.S.A.

As Now Subject.

~~IN S.R.L. APPENDIX~~
Indents in side shell plating (p & s).
Poop side (p.s) indented.



© 2021

Lloyd's Register
Foundation

FB
8/7/64