

13 APR 1960

Received from Chief Ship Surveyor

SHIP'S NAME "SAN SALVADOR" REPORT Fal. No. 13726

GB

Outstanding Conditions of Class: SUBJECT to sternframe at top
(E.W. & reinforced 10,57) being specially examined at the next
drydocking.

S.R.L. Appendix. (As before ~~xxx None~~)

Nature of Present Survey: (~~At sea~~ in dry dock)

Docking: Damage (cause unknown) involving shell plating (p & s),
bilge keels (p & s) and rudder horizontal coupling.

Recommendation:

SUBMITTED record of 'DS 2,60' be assigned,
subject as above, and to indented shell plates
F.5 & 6, G.6 & 7, H.5 & 6 (p.s. from fwd), also
to bolts in rivet holes being dealt with and
shell plates J.4, H.5, 6, 10 & 13 (p.s. from fwd)
and H.6, 7, 9, 11 & 13 (s.s. from fwd) and to
wastage in flanges of rudder horizontal coupling
being specially examined and dealt with
as necessary next drydocking before ship
resumes service.

DS 2,60 Subject
IN S.R.L. APPENDIX

Shell plate H.4 (p.s. from aft) indented.

NOTE:- Surveyors state ship is now laid up - see also Owners'
letter dated 9.2.60.

Elk (new)

C.S.S. Records Dept.
RECORDED
to note DEPT.

Lloyd's Register
Foundation

005321-005324-0018