

Chief Ship Surveyor

Received from Chief Ship Surveyor

NAME Steel S.S. "SCYTHIA".

Rpt.

Brw. No1892

marks of the Chief Ship Surveyor are desired on this case for the consideration of the Classing Committee.

("The endorsement to contain a succinct summary of any repairs that have been required and to show the cause or causes of such repairs, and also to bring out clearly any exceptional features in connection with the case, so that the Classing Committee may have all the salient points presented in the endorsement."—Extract from Sub-Committee's Report, 24/5/02.)

Survey

This vessel has proceeded to Lorient (France) for the completion of joiner work and other details.

To complete the survey there remains:- Both the forward and the after peak hand pumps to be tested. Deep ballast tank in No.2 hold:- Relief valves and connections at L.W.L. to be completed. The W.T. covers on G deck to be made satisfactory. The crown of the tank at the after end in way of valve rods to be made watertight. The scuppers on both sides, draining the tank top, which pass through the deep tank and empty into No. 3 hold bilges, to be made watertight. The deep ballast tank to be retested on the completion of the above.


Watertight doors:- The hand gearing of all doors between D and E decks to be tested, with the exception of the door on No. 34 bulkhead, and the door on the port side of No. 64 bulkhead. Stone-Lloyd W.T. Doors:- Nos. 3, 5 and 7 doors to be retested (lap not satisfactory). No. 4 door between E and F decks to be tested.

All the hand gearing to the Stone-Lloyd doors to be tested with the exception of No. 8 door, (No. 34 bulkhead). All W.T. door gearing to be cased in as found necessary.

Hatches:- The battening of the after end of No. 5 hatch on B deck and the fore end of No. 6 hatch on C deck to be made satisfactory. The after battening cleat on the port side of No. 5 hatch to be renewed, and one to the opposite hand fitted. The forward battening cleat of No. 6 hatch on the the starboard side to be renewed, and one to the opposite hand fitted.

P.T.O.

2/1 7/100-992500-853500

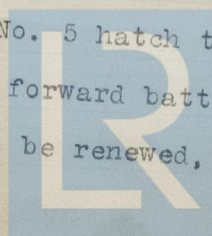

Lloyd's Register
Foundation

Part On the trial trip a slight leak was discovered in the shell on the starboard side of No. 1 hold in way of the launching eye-plate between the upper panting stringer and G deck:- To be overhauled and made satisfactory.

The Register tonnage to be verified on completion.

Pumps:- The emergency bilge pump in the boiler room, which is fitted in lieu of hand pumps to be seen under working conditions.

E.R. Bulkhead:- Hole $2\frac{1}{2}$ " diameter in lowest tween decks to be filled up.

Damage. When leaving the Ramsden Dock, Barrow-in-Furness, on the 23rd. March 1921 for the trial trip, the vessel collided with the quay wall at the dock entrance and damaged the port propeller.

On examination of the interior of the vessel at the after end on the port side, it was found that one frame at the after end of No. 7 hatch between E and F decks was slightly buckled and one cement chock on F deck was broken. The Surveyors recommend the vessel be placed in dry dock for further examination.

It is submitted the Nantes Surveyors be advised as above.

dr. 15-4-21

M *H.D.*
14. 4. 21.

The Nantes Surveyors should be requested to forward the usual Ship fittings & Casting reports.

dr 15-4-21



© 2021

Lloyd's Register
Foundation

005358-005366-0017 2/2