

COPY.

Lloyd's Register of Shipping.



Port

YOKOHAMA.

22nd May, 1940.

This is to Certify that

K. Kishigami,
the undersigned Surveyor to this Society did at the request of
the Owners' representative survey the Twin Screw Steamer
"ZUIYO MARU", 7385 tons gross, of Yokohama, on the 22nd April,
1940, and subsequently whilst the vessel lay in dry dock at
Messrs. Asano Dock, for the purpose of ascertaining the nature
and extent of damage stated to have been caused by Port propeller
striking some submerged object whilst on a voyage from Oha to
Tokuyama and Yokohama.

For further particulars see Log Books.

The undersigned upon examination.

FOUND

Damage to Port propeller.

One bronze blade partly broken on
leading edge, about 6 inches deep x
14½ inches wide, at 20½ inches apart
from end, and also cracked on same
edge, one is 4½ inches deep and
other is 1½ inches deep.

Broken part to be cut
out, cleaned and welded
up with a new piece of
same material and
cracked parts to be cut
out and welded up in
good order.

All the removals or
disturbed work for
access to the damage
repairs to be made in
good order.

Continued.


This Certificate is issued upon the terms of the Rules and Regulations of the Society, which provide that:—

"While the Committees of the Society use their best endeavours to ensure that the functions of the Society are properly executed, it is to be understood that neither the Society nor any Member of any of its Committees is under any circumstances whatever to be held responsible for any inaccuracy in any report or certificate issued by the Society or its Surveyors, or in any entry in the Register Book or other publication of the Society, or for any error of judgment, default or negligence of any of its Committees or any Member thereof, or the Surveyors, or other Officers or Agents of the Society."


T.Sc.S. "ZUIYO MARU".

The above recommendations, have now been made and carried out to my satisfaction in order to place the vessel in as good a condition as before she sustained the damage in question.

Fee as per account.

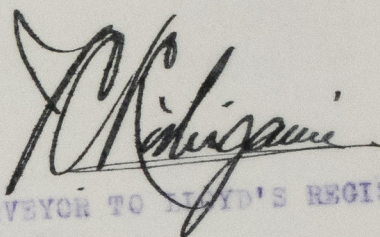

SURVEYOR TO LLOYD'S REGISTER.

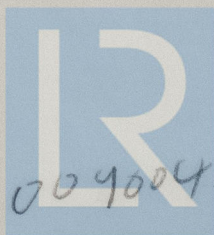

© 2021

Lloyd's Register
Foundation

009004-009007-0083

2/2