

COPY

LLOYD'S REGISTER OF SHIPPING

SEDE CENTRALE: 71, FENCHURCH STREET, LONDON, E.C.3

Ufficio Principale per l'Italia

Via Sottoripa, 1^a/112 - Genova (327)

Casella Postale (P.O.B) 232

Telefoni N.ri: 290.741 - 290.742

Telegrammi: Surveyors, Genova

Genoa, 27th October, 1958

Dear Sir,

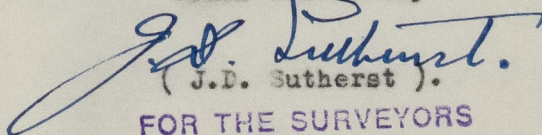
"BRITANNIA"

Further to our letter of the 25th inst. referring to the items and recommendations made for the completion of the Special Survey, please note that the following additional items should be dealt with :-

Fore Peak Tank :-

- 3 beams of tank top, standing flanges wasted - standing flanges to be burnt off at root and renewed
- 1 sounding pipe (SS) wasted - to be renewed.
- (PS) fracture in shell panting stringer at aftermost frame slot to be electrically welded and collared.
- 1st shell frame from collision bulkhead P. & S., standing flanges wasted at lower sections - standing flanges to be burnt off & renewed up to existing butt weld of previously renewed frames.
- 2 panting stringer stripping brackets (1P. & 1S.) at about mid-height of tank, wasted - to be renewed.
- Cement in way of fitting of (PS) hawse pipe to shell (leakage) - cement to be removed and hawse pipe connection to shell made watertight.

Yours faithfully


(J.D. Sutherst)
FOR THE SURVEYORS

W.J. HIPWELL, Esq.
MALTA.

JDS/cm.



© 2021

Lloyd's Register
Foundation

009522-009526-0177