

Rpt. 8.

5 DEC 1954

No. 6069

# REPORT OF SURVEY FOR REPAIRS, &c.

Date of writing Report... 9/12/1954 When handed in at Local Office... 9/12/1954 Port of Rio de Janeiro  
 No. in Reg. Book Survey held at Rio de Janeiro Date, First Survey 15/11/1954 Last Survey 9th December 1954  
 on the Wood, Iron or Steel sc. steamer "CAMBOINHAS"  
 5/1959

TONNAGE: Built at Sunderland By whom Sunderland S. B. Co. Ltd. When 1913 TONNAGE: 1,129  
 GROSS 1,129  
 UNDER D.K. 3747  
 NET 2557 Owners Cia. Navegação e Comércio Pan-Ame-Owners' Address -  
 Managers - ricana.  
 (If not already recorded in Appendix to Register Book).  
 Port belonging to Pernambuco

Surveyed Afloat or in Dry Dock? Drydock Name of Dock Dique Rio de Janeiro Destined Voyage  
 Cell DB or DBa feet; U.E & B. feet; f. feet |  
 total capacity tons. F.P.T. tons; A.P.T. tons; M.T. feet tons |  
 Only alterations in the existing records of tanks should be inserted.

N.B.—All alterations in the existing records should be underlined.

Last Report, No. 5795 Port Rio -

Particulars of Classification (which must be inserted precisely as in Register Book & Supplements)

CHARACTER  
 \* for Special Survey.  
 Date of last Survey and of Periodical Surveys.

Machinery and Boiler Surveys  
 (Including date of N.B., if any).

+100A1 - 1,53	+LMC 8,51
Reclassified 1,53	BS 1,53
ss Rio. - 8,51 (Dr.)	TSCL 7,51

Society's Freeboard (if assigned) as painted on Ship and now verified 4 ft 8 3/4 ins.

Was a damage report made by anyone else? if so, by whom?

REPAIRS OR EXAMINATION AS PER RULE FOR Annual Survey in drydock.  
 Vessel placed in drydock. Bottom and rudder, cleaned, examined and recoated. Rudder lifted.  
 Examined decks, hatches and hatchways, with closing and securing appliances, exposed casings, superstructure bulkheads, companionways, ventilator coamings, air pipes, fiddley openings and skylights and all closing appliances, also ash shoot openings in ship's sides and freeing arrangements. The freeboard markings verified. Examined steering arrangements, with rods and chains dismantled. The auxiliary steering gear assembled and ascertained same in good working order.  
 Repairs for Wear and Tear:- Aft well port bulwark plating removed for a length of about 10ft., the gunwale angle and stringer plate in way released, all faired and refitted and riveted. № 3 hatch port side coaming released, faired and riveted with new mountings fitted. All (4) bridge deck side bunker hatchways faired and mouldings repainted. Bridge deck stringer in way of port (pto.).

SUMMARY OF DAMAGE REPAIRS	Shell Plates	Frames	R. Frames	Floors and Bracket Floors	Beams	Inner Bottom Plates	Dk. Plates	Other Items
Repaired								
Removed and Painted or Repaired								
Painted or Repaired in place								

PRESENT CONDITION OF THE								
Decks	good					Engine Room Skylights	good	Copper, or Y.M.
Carpentry of Decks	good					Coal Bunkers, Openings, Covers, &c.	-	Side of Port.
Coatings	good					Oil Bunkers	-	When fitted, Month
Beams & Framing	-					Scuppers	-	Year
Outfitting Materials	good					Cargo Hatchways	good	Boats
In way of fittings	-					Hatches	good	good
Projections	-					Planking	-	Masts, Yards, &c.
Revered frames	-					Caulking	-	Commodities, how ascertained from deck
Longitudinal	-					Treenails	-	(State if wedges removed.)
Transverse	-					Breasthooks & Stemson	-	Equipment letter
Floors	-					Transoms, Pointers & Crutches	-	W.
Membranes	-					Timbers of Frame at Openings	-	Anchors, No. of 3B 1S
Springers	-					" at other places	-	Cables (State if now ranged) no
Inner Bottom Plates	-					Stringers, Clamps & Shelves	-	" length (on board) mean diamr.
Have the Tanks been cleaned? no						Sealing	-	" Rule length size
Are the Tanks clean? yes						Sails	-	Chain Locker
								Hawsers & Warps stated complete
								Standing and Running Rigging & good

## General Observations, Opinion as to Class, Recommendation, &c.:-

State clearly whether any and, if so, what alteration is suggested to be made in the existing classification and notification of the vessel in the Register Book consequent upon this survey, for example, "to remain as classed and to have record of Survey," "to remain as classed and to have record of Survey, &c., and the notations of No. 1-38."

This vessel is eligible, in my opinion, to be continued as classed with fresh record of Annual Survey in drydock 11.54

SPK  
20-12-54

Survey Fee (see Section 24) & R.P.S. \$3,000,00

Fee applied for,

9.12.1954

Special Damage or Repair Fee (if any)

550.00

Received by me

Travelling Expenses (if chargeable)

Second Surveyor's Fee (if any)

TUESDAY - 4 JAN 1955

Committee's Minute

1/54 Rio

5.11.54 35 12.54

R.P.S.

W. Caldwell 2020  
 Surveyor to Lloyd's Register of Shipping  
 Lloyd's Register Foundation

forward side bunker hatch renewed.

About 50 hatch covers renewed.

All rudder pintles renewed. All steering chain guides rebushed and several rod eye pins renewed.

Examined the windlass, anchors and cables so far as accessible.

If this Report is adopted by Congress, it will be taken that the committee wishes to have it published as it stands, in order to show through its other side, the views of those who opposed it.

When Anchors or Ticles are supplied, the particular are to be reported in the following form:-

吳昌碩

When a new country is founded it must decide right whether it is or isn't true, & the

卷之三