

"ANTHIPPI MICHALOS" - Built 1933-10.

SPECIAL SURVEY (D) due 9,58 - commenced Lon.9,58 -
see Lon.Rpt.No.138916.

CLASS EXPUNGED - reported defects 14.11.58.

A letter dated 25.11.58 from Owners'
Agents requests re-consideration of the expunged notation.

The following list of the recommended repairs
outstanding when the Special Survey was stopped (22.9.58)
was extracted from the above mentioned report.

"Bottom andside shell riveting in way of a number of shell
butts corroded and requires renewing.

 
Tank top plating in holds extensively buckled and set down
in parts particularly at forward end of holds. Approximately
10 plates in each hold to be renewed.

Floors and reverse frames in way found buckled and riveting
in way generally started or missing to be dealt with
as necessary.

Shell frames (p & s) at forward end of each hold found
buckled. Approximately 10 frames (p & s) in No.1 hold and
5 frames (p & s) in No.2 hold to be renewed.

Shell plates G.8 (p.s.) and F.6, 7 & 8, G.6, 7 & 8 (s.s.)
to be renewed.

No repairs effected at this time."



26.11.58.



© 2021

Lloyd's Register
Foundation