

Rpt. 8

Port GLASGOW

WRECK
SECTION No. 93818

Date of writing Report 18.8.62 When handed in at Local Office 23.8.62 Received London 23.8.62
Survey held at GLASGOW No. of Visits 9 First Date 30.7.1962 Last Date 2.8.1962

REPORT OF SHIP SURVEYS AND REPAIRS

(The Surveyor's attention is drawn to the relevant requirements of Chapters B & C of the Rules.)

30 AUG 1962

No. in R.B. 74845 on the Iron or Steel M.S. "NORDIC" Tons gross 9485
Built at Sunderland By Whom J. L. Thompson & Sons Ltd. Year 1943 Month 10
Owners Prince Line Ltd. Owners' address (If not already in R.B.)
Managers Furness Withy & Co. Ltd. Port of Registry London
Surveyed Afloat or in Drydock Both Name of Dock Merklands Quay & Govan Dry Dock Date of last examn. in Drydock 7.8.62
N.B.—Any alterations in existing particulars in the Register Book should be reported and underlined.
Last Report: No. 19467 Port Mel
To be filled in at Head Office.

Particulars of Classification (which must be inserted precisely as in Register Book and Supplement)

Surveys must be reported in the terms of the Rules. The nature and extent of Examinations and Repairs (if any) must be stated in detail, the parts examined and their condition being clearly indicated. For Annual, Special or other Condition Surveys the Summary of Examination and Condition on the back of the Report is to be carefully completed and amplified if necessary in the body of the Report. Outstanding items to complete the Survey should be summarised at the end of the Report. The reasons for Repairs must be stated. Repairs on account of Damage (the alleged cause of which must be stated) should be separated from Repairs due to other causes, and, besides being detailed in the body of the Report, should be summarised in the form below. When, at a Special Survey, the Shell and Deck Plating is drilled the results must be reported on Report 8(Dr). Whenever Anchors or Chain Cables are replaced or retested the necessary particulars are to be given on Report 8(Eq) which is to be attached to this Report.

Give dates and references to any letters relating to this Report

SHIP'S CLASS	Machinery
Date of Special and of Drydocking Surveys, etc.	
+ 100A1 with freeboard 8.61	+ LMC C.S. 2.61
S.S. 8.61	D.B.S. 8.61
	T.S. C.L. P.8.61
Butts of Keel & Fwd. Side	S.8.61
Shell Plg. E.W.	SPS. 7.60
C.S.D.	Oil Engines

In damage cases where the Surveyor has not made a special damage report he should state whether he offered his services for this purpose and to whom and why they were declined

Freeboard as marked on ship and now verified 3 ft 7 1/2 ins

Was a damage report made by anyone else? If so, by whom?

EXAMINATION AND REPAIRS AS PER RULE FOR DAMAGE REPAIRS AND DOCKING

Damage stated to have been sustained through:-

1. Grabs while discharging cargo at Whangerei and at Mt. Maunganie between 2nd and 13th October, 1961.
2. Contact with tug "HEADMAN" at Hull on 8th January, 1962.
3. Contact with M.S. "FINN GERMA" off OSTERORT on 16th January, 1962.

Damage No. 1

Now done:- Tank top plating No. 4 Hold (No. 6 D.B. tank) P. & S.

Tank top plating in strake abreast tunnel side, forward of forward pillar, buckled - cropped and part renewed.

Tank top plating (p. & s.) abreast tunnel side buckled - removed and renewed.

On completion of repairs the No. 6 D.B. tank was pressure tested and found satisfactory. This item may be deleted as a condition of class.

Damage No. 2

Now done:- Side shell No. 1 Hold S.S.

Shell plates 'J' 18 & 'H' 17 from aft (S.S.) set in - cropped and part renewed.

Bulkhead wing plate between Nos. 1 & 2 Holds buckled - cropped and part renewed.

CONTINUATION OVER/OR SHEET 2

SUMMARY OF DAMAGE REPAIRS	Shell Plates	Frames	R. Frames	Floors and Bracket Floors	Inner Bottom Plates	Deck Plates BHD.	Beams	Other Items
Renewed	384 pt.	2 pt.			2 1/2	1 pt.		as per body of report.
Removed and Faired or Repaired								
Faired or Repaired in place	4	1						

Has a Survey also been held on machinery of the Ship? Yes

Is Classification Certificate required? If so, to be sent to

If so, is the Report sent now, or when will it be sent? NOW

Has Interim Certificate been issued? Yes

GENERAL OBSERVATIONS, OPINION AND RECOMMENDATION AS TO CLASS

State clearly what alteration, if any, is suggested to be made in the existing Classification or Survey or other records of the Ship in the Register Book consequent upon this survey; for example:—"to remain as Classed in the Register Book without fresh record of Docking"; "to remain as Classed and to have record of drydocking 1.55"; or "to remain as Classed and to have record of drydocking 1.55, and the notation of S.S. . . . 1.55".

This ship so far as now surveyed is eligible in our opinion to remain as classed with fresh record of docking 8.62 subject to 'A' 17 (p) being examined and dealt with at the next special survey but without conditions regarding tank top plating in No. 4 Hold, set in shell plates 'J' 18 and 'H' 17 etc. and stem plating and structure in way.

James F. Edgar & D. J. MacLachlan
Surveyor to Lloyd's Register of Shipping
(JAMES F. EDGAR & D. J. MACLACHLAN)

Date of Committee


Minute

DS 8.62, subject (HAM)

DBS 8.62

Noted for Header

20m.10.61 T. (MADE AND PRINTED IN ENGLAND)

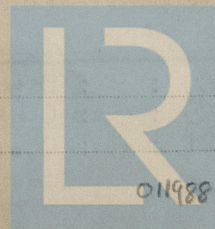

© 2021

Lloyd's Register Foundation

011988-011994-0131 1/2

Damage repairs and docking

Have the spaces now surveyed been cleared and cleaned as necessary?.....

Have the close ceiling and cargo battens, linings, pipe casings, etc., been removed and replaced as required by the Rules?.....

Have the bilges been cleaned out and examined?..... No..... Has cement in bottom been examined?.....

Has steelwork had rust removed and afterwards been recoated as necessary?.....

Were inspection plugs or any insulation removed in insulated spaces for examination of steelwork?.....

Has a Load Line Survey been held?..... Yes..... If so, state which Annual.....

Have the shell and deck plating been drilled as per Rule?..... If so, Report 8(Dr) to be attached.....

Have any alterations to the approved scantlings and arrangements now been effected?..... If so, report details in body of Report.

NOTE:—Indicate which compartments and/or tanks have been examined or tested by giving the identification numbers and inserting the word “Yes”, e.g. Holds: Nos. 1, 2 & 3—Yes; or All—Yes.

The present condition of the following parts in so far as examined is to be reported:—

appendix
Have conditions (A) or ~~endorsements~~ (B) of Class (if any) been dealt with? 'A' Yes pt. 'B' No. See Below.

Damage	No. 1	£9	:	9	:	0
	No. 2	£5	:	5	:	0
	No. 3	£21	:	0	:	0

Second Surveyor's Fee (if any)

Date when A/c. Rendered 24 AUG 1962

ort of G L A S G O W

Continuation of Ship/Mechy. Report No.

dated 18.8.62.

30 APR 1962

on the S.S./M.S. "NORDIC"

DAMAGE REPAIRS AND DOCKING CONTINUED:-

Damage No. 3 Continued:-

Soft nose stem plate No. 2 buckled and torn - removed and renewed.

'G' strake plate No. 21 (p) buckled - heated and faired in place.

" " " No. 21 (p) " " " " " "

" " No. 20 (p) " - cropped and part renewed.

'J' " " Nos. 21 & 22 (p) buckled - removed and renewed.

'H' " " No. 21 (s) buckled - cropped and part renewed.

'J' " " No. 22 (S) " - removed and renewed of extended length.

'J' " " No. 21 (s) " - repaired by plate above.

'K' " " No. 22 (s) " - heated and faired in place.

2 frames (p) buckled - cropped and part renewed.

and there was no place to transfer the oil.

Owing to the nature of the damage, the permanent repair was deferred until the next special survey.

F.P. tank top plating at the stem buckled - cropped and part renewed.

2 Breast hooks in F.P. tank buckled - removed and renewed.

area of the shell was hose tested and all found satisfactory.

This item may now be deleted as a condition of class.

REPAIRS - WEAR AND TEAR:- All hatch coamings, roller beams, securing clamps to all hatches overhauled and made good. Spare securing clamps supplied to ship. Other minor repairs effected.

Conditions of Class:- Indented tank top plating in No. 4 Hold - dealt with under
Damage No. 1.

Shell plates 'J' 18 and 'H' 17 etc. - dealt with under Damage No. 2.

Stem and stem plating - dealt with under Damage No. 3.

These items may now be deleted as conditions of class.

Appendix to S.R.L.:- Poop sheer plating and shell plating (s.s.) indented - examined
and found efficient meantime.



© 2021

Lloyd's Register
Foundation

0131 2 1/2