

5 NOV 1964

Ship's name SS "LANTAO"

Port KOBE

No. 13141

Last survey date

Class is subject to

29.6.64

S.W. Crapwater not being used until repaired.

Docking - wear down 3.75mm.

TS due 12.68 - now held

MBS due 10.63 - now commenced. (Port, center
+ stbd. boiler mountings, furnaces
+ combustion chambers only examined).

Surveyor reports alleged grounding damage
to propeller blades & Owners intention to fit
new propellers at this time.

Screw shaft cracked at large end of cone
+ spare screw shaft to fit.

Stem tube bulk cracked at securing flange
+ to be repaired with metalwork.

Same repairs to effect to main & aux. machinery
+ stbd boiler cracked front end plate to
repair with welding.

Surveyor reports during survey the Owners
intention to withdraw ship from classification
with the Society & the repairs & renewal
recommended as a result of the survey
therefore not seen.

Continued:

Lloyd's Register
Foundation

Ship's name ^uSS LANTAO

Port

No.

Class is subject to

Last survey date

The Society has already been informed of the Owners intention to withdraw ship from class (see letter 13.7.64) & the notation of "Class Withdrawn" was posted in the Register Book 8.64.

Submitted that in view of the above no further action need be taken.

TGP

4.11.64



© 2021

Lloyd's Register
Foundation