

22.5.64

Ship's name "LANTAO" Port Sng No. 17396

Last survey date 23.5.64.

Class is subject to For conditions of class see previous endorsement.

ACTION is DEFERRED for examination in dry dock after grounding.

S.R.L. Appendix (as before ~~xxxxxx~~)

Nature of present survey (afloat and in drydock) ~~xxxxxxxxxxxxxxxx~~

Temporary repairs due to fractured shell plating.

Recommendation

SUBJECT to bottom shell plates B.2 & C.1 (p.s.f) being specially examined and dealt with as necessary and shell plating in 2nd strake below sheerstrake in way of No.5 hold (s.s) being permanently repaired next drydocking also to fractured shell plating (s.s) in way of frame 121 in 3rd strake below sheerstrake and frame 135 in 2nd strake below sheer and shell plating in way of frames 15 & 107 (s.s) and 17 (p.s) in 2nd strake below sheer (temporarily repaired) being specially examined and dealt with as necessary by 6.64, but ACTION be DEFERRED for examination in drydock after grounding.

SUBJECT AMENDED.

P.T.O.

Ships Register Foundation

24/5/64
X

IN S.R.L. ~~APPENDIX~~.

Drydocking(grounding).

IN S.R.L. ~~APPENDIX~~.

Indented shell plating (s.s.f)
also shell plates C.3 & D.6 (p.s.f).

NOTE:- It is stated that on discharge of present cargo
the ship is proceeding to a Japanese port for
drydocking.



© 2021

Lloyd's Register
Foundation