

Bce by 5/4/65  
(r Rpt. No. 8258)

---

Cracks in 3 crankpins of  
both M.E's (worst in Stbd shaft)

---

Cracks ground out but no  
crack detection on completion

---

Crack detection of pins by  
7.65 recommended, and  
renewal of Stbd shaft by 1.66.

---

Bce by 8329 (9.65)

---

Request for survey rec'd 11 am.,  
but no survey or availab.  
until 4 pm. by which time  
stbd M.E. had been boxed  
up.

Port shaft crack detected &  
limit extended to 1.66  
due to vessel's commitments  
nothing else could be done

---

Tech opinion is that renewal  
of stbd. shaft could be pp'd  
beyond 1.66 subject satisfactory  
crack detection. 013671-013677-0004