

013750 - 013759 - 0214

Ship's name *PROODUS*

Port *Rotterdam*

20 MAY 1965  
No. *60184*

SRL app. *M.*

Last survey date *30.9.64.*

Class is subject to

*Locking - Examination of TS - wear down 3.5 mm.  
mach. exam. on account of damage.*

*Surveyor reports crack in TS cone at edge of keelway.  
Intermediate shaft out of line.*

*Thrust pads worn & cracked.*

*Shaft fit of N°3 fwd side crank on fwd web. of N°3 centre  
web defective - shift of 2 mm.*

*ME bedplate guides in way of welding cracked.  
Part of 1 prop. blade broken off & remaining tips  
damaged.*

*Recommendations for repairs were made to  
Owners Sup<sup>t</sup> by Surveyors but no repairs were  
carried out under the supervision of the  
Society's Surveyors. Surveyors report that  
vessel has been laid up for months at Rotterdam.*

*It is noted that "Class withdrawn  
reported defects" was assigned 26.2.65.*

*R.G. 18/5/65*

Lloyd's Register  
Foundation