

Rpt. 8

Date of writing Report Aug. 22, 1960

When handed in at Local Office

Port Cleveland, Ohio 19 OCT 1960 No. 2304

Received London

Survey held at Superior, Wisconsin

No. of Visits 1

First Date Aug. 12 1960

Last Date Aug. 12 1960

## REPORT OF SHIP SURVEYS AND REPAIRS

(The Surveyor's attention is drawn to the relevant requirements of Chapters B & C of the Rules.)

No. in R.B.

62462

on the Iron or Steel M.S.

-SS-

"GIOVANNELLA D'AMICO"

Built at Venice

By whom CANT. NAV. BREDA

Tons Gross 12983  
Year 1959  
Month 3

Owners D'Amico Societa Di Navigazione

Owner's address  
(If not already in R.B.)

Managers

Port of Registry Palermo

Surveyed Afloat or in Drydock Afloat

Name of Dock

Date of last examn. in Drydock 3.59

N.B.—Any alterations in existing particulars in the Register Book should be reported and underlined.

{ Last Report: No. 50145 Port ROT  
{ To be filled in at Head Office.

Particulars of Classification (which must be inserted precisely as in Register Book and Supplement)

Surveys must be reported in the terms of the Rules. The nature and extent of Examinations and Repairs (if any) must be stated in detail, the parts examined and their condition being clearly indicated. For Annual, Special or other Condition Surveys the Summary of Examination and Condition on the back of the Report is to be carefully completed and amplified if necessary in the body of the Report. Outstanding items to complete the Survey should be summarised at the end of the Report. The reasons for Repairs must be stated. Repairs on account of Damage (the alleged cause of which must be stated) should be separated from Repairs due to other causes, and, besides being detailed in the body of the Report, should be summarised in the form below. When, at a Special Survey, the Shell and Deck Plating is drilled the results must be reported on Report 8(Dr). Whenever Anchors or Chain Cables are replaced or retested the necessary particulars are to be given on Report 8(Eq) which is to be attached to this Report.

Give dates and references to any letters relating to this Report

SHIP'S CLASS  
Date of Special and of Drydocking Surveys, etc.

Machinery

\* 100 A 1

\* L M C

E S 3.59

D B S 3.59

T S (CL) 3.59

In damage cases where the Surveyor has not made a special damage report he should state whether he offered

his services for this purpose and to whom and why they were declined. Freeboard as marked on ship and now verified --- ft. --- ins.

not required

Was a damage report made by anyone else? If so, by whom? Underwriters

EXAMINATION AND REPAIRS AS PER RULE FOR

Damage:- Stated to have been sustained August 2, 1960 when the vessel grounded in the lower St. Claire River whilst passing Peche Island.

Found:- Internal examination made of tanks and the following damage noted:-

Nos. 1, 2 & 3 starboard wing cargo tanks - B strake set up lightly for a length of 60 ft. x 20 inches wide. High floors and side keelson in No. 2 tank lightly disturbed.

No leakage found anywhere throughout vessel.

RECOMMENDED:- Permanent repairs were deferred at the Master's request to be carried out at the next drydocking. No temporary repairs required.

CONTINUATION OVER/OR SHEET 2

SUMMARY OF DAMAGE REPAIRS	Shell Plates	Frames	R. Frames	Floors and Bracket Floors	Inner Bottom Plates	Deck Plates	Beams	Other Items
Renewed								
Removed and Faired or Repaired								
Faired or Repaired in place								

Has a Survey also been held on machinery of the Ship? No

Is Classification Certificate required? If so, to be sent to No

If so, is the Report sent now, or when will it be sent? ---

Has Interim Certificate been issued? Yes

GENERAL OBSERVATIONS, OPINION AND RECOMMENDATION AS TO CLASS

State clearly what alteration, if any, is suggested to be made in the existing Classification or Survey or other records of the Ship in the Register Book consequent upon this survey, for example:—"to remain as Classed in the Register Book without fresh record of Docking"; "to remain as Classed and to have record of drydocking 1.55"; or to remain as Classed and to have record of drydocking 1.55, and the notation of S.S. . . . 1.55".

This vessel is, in my opinion, eligible to be continued as now classed without fresh record of survey (subject to bottom shell being specially examined for grounding damage at the next drydocking.)

For: L. Dahlgren, Acting Surveyor

R. S. Naugren  
Surveyor to Lloyd's Register of Shipping

Date of Committee

NEW YORK

SEP 21 1960

Minute

Deferred for drydocking/grounding



© 2021

Lloyd's Register  
Foundation



TABLE 1

PARTS OF THE SHIP AS INDICATED BELOW HAVE BEEN EXAMINED

SURVEY

Items	Now Examined YES NO or NONE	Tanks	Now Examined Internally	Now Tested
Shell plating, sternframe and rudder cleaned, examined and recoated in drydock		F.P. Tank		
Rudder lifted		A.P. "		
Weather Decks, Superstructures and Casings		D.B. Tanks (indicate Oil Fuel) and Cofferdams		
Hatchways, Covers, closing and securing appliances				
Ventilator coamings, skylights, companionways and closing appliances		Fresh Water Tanks		
Holds		Deep Tanks		
		Oil Fuel Bunkers and Settling Tanks		
Tween Decks		Side Tanks		
		Wing Tanks		
Fore Peak Spaces		Other Tanks		
After " " "				
Engine Space		Cargo Tanks (Tankers)		
Boiler " " "				
Under Engines and Boilers				
Tunnel and Well		Cofferdams		
Coal Bunkers		Pump Rooms		
Chain Locker				
Other Spaces				
		Have Tanks now Examined been Cleaned as Necessary?		
		Have Strums in Cargo Tanks (of Tankers) been removed?		
		Have Tanks been Retested as necessary after completion of any Repairs?		

Have the spaces now surveyed been cleared and cleaned as necessary?

Have the close ceiling and cargo battens, linings, pipe casings, etc., been removed and replaced as required by the Rules?

Have the bilges been cleaned out and examined?

Has steelwork had rust removed and afterwards been recoated as necessary?

Were inspection plugs or any insulation removed in insulated spaces for examination of steelwork?

Has a Load Line Survey been held? If so, state which.

Have the shell and deck plating been drilled as per Rule? If so, Report 2 (Dr) to be attached.

Have any alterations to the approved scantlings and arrangements now been effected? If so, report details in body of Report.

NOTE:—Indicate which compartments and/or tanks have been examined or tested by giving the identification numbers and inserting the word "Yes", e.g. Holds: Nos. 1, 2 & 3—Yes; or All—Yes.

TABLE 2

The present condition of the following parts in so far as examined is to be reported:—		
Shell plating	Ceiling and Cargo Battens	Sluice Valves examined and found
" " in way of side scuttles	Cement or Asphalt	Air and Sounding Pipes
Rudder and Sternframe	Cargo and other Hatchways	Doubling Plates under Sounding Pipes
Decks	Hatches and closing appliances	Masts and Rigging examined and found
Superstructures and their closing appliances	Ventilators, their coamings and closing appliances	Condition, how ascertained (State if wedges removed)
Coamings and Casings	Companionways and Skylights	Chain Locker
Beams and Fastenings	Shell Openings	EQUIPMENT
Frames	Ash Shoots	Equipment Letter
Reverse Frames	Overboard Discharges and Scuppers	Anchors, No. of Condition
Longitudinals	Freeing ports	Cables (State if now ranged and examined)
Transverses	Steering Gear (Main and Auxiliary) examined and found	" length mean diam (on board)
Floors	Windlass examined and found	" Rule Length Size
Keelsons	Pumps " " "	Hawsers and Warps
Stringers	W.T. Doors " " "	State if any Anchors or Chain Cable have now been supplied or retested, if so, complete Report 8 (Eq) and attach.
Inner Bottom Plating		
Bulkheads and Tunnel		

Have conditions (A) or endorsements (B) of Class (if any) been dealt with? See Below

REMARKS, REPAIRS, Etc. (Contd.)

Survey Fee \$ 70.00

Special Damage or Repair Fee (if any)

Travelling Expenses (if chargeable) \$ 12.00

Second Surveyor's Fee (if any)

Date when A/c. Rendered Aug. 22, '60

Lloyd's Register Foundation