

REPORT OF SHIP SURVEYS AND REPAIRS

Received London

Ship's Name SS/MS "HONGKONG VENTURE" 7253 Gross tons

Is there a rpt. 9? No

Port Newcastle, NSW. Rpt. No.

8417

No. of visits 2

First date 5.3.64.

Last date 6.3.64.

Interim Cert. issued  
& copy herewith? Yes

Damage rpt. issued  
& copy herewith? --

Last rpt. (H.Q. only) KOB 12230

Date of completing rpt. 10.3.64.

Surveyed at, if different from Port above

Surveyed afloat and/or in D.D.	Afloat
1	
2	
3	
4	
5	
6	
7	
8	
9	
10	
11	
12	
13	
14	
15	
16	
17	
18	
19	
20	
21	
22	
23	
24	
25	
26	
27	
28	
29	
30	
31	
32	
33	
34	
35	
36	
37	
38	
39	
40	
41	
42	
43	
44	
45	
46	
47	
48	
49	
50	
51	
52	
53	
54	
55	
56	
57	
58	
59	
60	
61	
62	
63	
64	
65	
66	
67	
68	
69	
70	
71	
72	
73	
74	
75	
76	
77	
78	
79	
80	
81	
82	
83	
84	
85	
86	
87	
88	
89	
90	
91	
92	
93	
94	
95	
96	
97	
98	
99	
100	

Last date of examination in D.D.

Has a Load Line Survey been held? No

Freeboard Marks verified

State which additional Rpt. 8 is attached: ~~(Com) (PS) (WFO) (EO) (WFO)~~

Survey fees £15.0.0.

Damage fee

Expenses £1.4.0.

S.A. fee

I have surveyed the above ship in accordance with the Rules for temporary repairs to leakage in shell plating in way of midship deep tank Port side.

The items now surveyed are detailed on this report. All were found or placed in good condition unless otherwise stated.

At the request of the Master and Agents an examination made for leakage in deep tank and the shell plates G11, H11 grooved and fractured in line with the after bulkhead Port side.

The shell plate H11 now doubled for full depth and the plate G11 doubled for approximately 4'0" in way of the grooving with  $\frac{1}{2}$ " plating.

It was stated that the vessel will be dry docked for Special Survey on the return to Japan this voyage and in my opinion the above repairs are efficient for the necessary period.

I recommend that this ship remain as classed ~~///~~ without fresh record of dry docking subject to all conditions at present attached to the class of the vessel being dealt with as previously recommended and to the shell plates G11, H11 Port side amidships being permanently repaired at the next dry docking.

(Where conditions of class are recommended to be retained, imposed, amended or deleted, particulars must be stated above and on the interim certificate)

Date of Committee

THURSDAY - 2 APR 1964

## Minute

Deferred for SS (by 4.6.64)  
(subject)

J. H. Cowell,  
Surveyor to Lloyd's Register of Shipping

Lloyd's Register  
Foundation

015474-015482-0037