

(Received at London Office TUES. APL 28 1896)

No. 14341

REPORT of SURVEY for REPAIRS, &c.

Date of writing Report 25th April 1896 When handed in at Local Office 27th April 1896 Port of Glasgow

No. in Reg. Book 365 Survey held at Ardrossan Date, First Survey 19th March, Last Survey 24th April 1896
on the Wood, Iron or Steel Sc 3mst Sr Golfer Master J. J. Buadian

TONNAGE:— Built at Aberdeen By whom J. Bulkie & Son & Co. When 1891 - 10
GROSS 377 Owners R. Thomson Port belonging to London
UNDER DE 299 Owners' Address
NET 189 (If not already recorded in Appendix to Register Book.)

Surveyed Afloat or in Dry Dock? Ardrossan Name of Dock Dry Dock and afloat. Destined Voyage not fixed.
WB=DBa tons, f tons; u&gB tons; CellDB tons;
FPT 50 tons; APT tons; MT tons.

If the vessel has Water Ballast Tanks, state whether the manhole covers have been removed, and the insides of the tanks examined. Also state the amount of deterioration (if any) found in the thicknesses of the floors, framing, girders, and of the inner bottom plating, especially in the boiler space.

Particulars of Classification (which must be inserted precisely as in Register Book & Supplements).

CHARACTER. * for Special Survey. Date of last Survey and of Periodical Surveys.	Years Assigned expired.	Machinery and Boiler Survey. (Including date of N.B., if any).
100A.1.		100C.
S.S. Sld net 95		6.95.
10.95.		

Last Survey, No. 57073 Port Low

Periodical Surveys, when held, must be reported in detail and serially in the terms of the Rules. State clearly the cause of Repairs, if any, and, in detail, the nature and extent of Examinations and subsequent Repairs. Repairs on account of Damage (the cause of which must be stated) should be separated from Repairs due to other causes; and besides being detailed in the body of the report, should be summarised in the form shown below. Whenever the replacement of Anchors, Chains, or Hawsers is reported, the particulars of weight or size and test of the articles should be clearly stated, and also the weight or size, &c., required by the Rules, together with the vessel's Equipment Letter, if any. State also the dates and initials of any letters respecting this case.

Society's Freeboard (if assigned) as painted on Ship and now verified 1 ft. 1 ins.

REPAIRS, OR EXAMINATION AS PER RULE, FOR repair of damage alleged to have been sustained on the 8th Jan/96 while proceeding from Tralee to Guernsey and entering the Harbour of St. Samson collided with a Schooner and damaged port bow. On the 11th Jan/96 while proceeding from Guernsey to St. Brieux grounded in St. Brieux Harbour twice; On the 24th Jan/96 by grounding in Canal while bound from Fleburg to Groningen; On 28th Jan/96 while bound from Groningen to Bristol and on entering lock at Delvyl struck wall; On 30th Jan/96 by grounding near Bengensis and remaining from 5.40 AM to 2 PM; also on 11th Mar/96 by touching the ground at Westport; and during Cyclone and tremendous Sea experienced on the 22nd & 23rd Mar/96 near Clearagh Island while proceeding from London to Westport. Vessel placed in dry dock, Keel bottom and sides cleaned down and beamish; the hatches in ceiling on each and the lumber boards on starboard side removed, and floors and Cement beamish; On port bow near aft end of forecastle 2 shell plates removed from D strake and 1 from E strake, set fair and replaced; 2 plates indentured on starboard side of forecastle faired in place; 3 pillars set fair; bridge rails & stanchions repaired; re-plated fore peak tank and recoated bottom & sides, damaged much keel stools and fastenings made good, lids of freeing ports repaired, bridge deck recoated, 1 ladder to bridge deck renewed, 2 boats repaired, Engine room skylight hinges repaired, ventilator to after cabin repaired, coils repaired, bridge cloth renewed, running gear repaired, steering gear examined. For further particulars please see brief copy of Damage survey report sent herewith.

SUMMARY OF DAMAGE REPAIRS:— 5 Plates, Faired or Repaired; 2 Frames, ditto. Plates, Renewed; Frames, ditto. Other Repairs 3 pillars set fair, bridge rails & stanchions repaired, &c. &c.

PRESENT CONDITION OF THE	Bubbling Plates under Sounding Pipes	Good	Copper, or Y.M.	Recoated bottom	Hatches	Good
Decks	Good	do	(State if on felt.)	When put on, Month Year	Boats	do
Waterways	do	do	Rudder	Good	Masts, Yards, &c.	do
Coamings	do	do	Windlass & Capstan	do	Condition, how ascertained	do
Up'r Dk. Beams & Fastenings	do	do	Pumps	do	Sails	do
Low'r Dk. Beams & Fastenings	do	do	Engine Room Skylights	do	Equipment letter	do
Plating	do	do	Coal Bunker, Open'gs, Lids, &c.	do	Anchors, No. of	do
Planking	do	do	Scuppers	do	Cables (State if now ranged)	do
Transoms or Rivets	do	do	Cargo & Main Hatchways	do	" length	do
Breasthooks & Stemson	do	do			" Rule length	do
					Hawsers & Warps	do
					Standing & Running Rigging	do

General Observations, Opinion as to Class, Recommendation, &c.:

State clearly whether any and, if so, what alteration is suggested to be made in the existing classification and notification of the vessel in the Register Book consequent upon this survey, thus, for example:—"to remain as now classed in the Register Book without fresh record of Survey," "to remain as classed and to have record of survey, 9,91," or "to remain as classed and to have record of survey, 9,91, and the notations of ss No. 1-91 and ptnd 91, &c."

The damage this vessel sustained having now been satisfactorily repaired, she is in good and efficient condition and eligible in my opinion to remain as classed and to have record of survey 4.96.

Office Fee (if chargeable) per Scale II., Sec. 27 £
Survey Fee (per Section 28) £
Special Damage or Repair Fee (if any) (per Sec. 28.) £
Travelling Expenses (if chargeable) £
Second Surveyor's Fee (if any) £

Fees applied for, 18/4/96
Received by me, 21/4/96

J. L. Minetto
Surveyor to Lloyd's Register of British & Foreign Shipping.

*Is Certificate now required?
Committee's Minute FRI, MAY 1 1896
Character assigned 100A.1