

REPORT of SURVEY for REPAIRS.

No. 312

Survey held at

London

Date

Feb 9. 17 21

1849

on the

M. Elizabeth

Master

Wm. A. F. Morris

Tonnage

457

Built at

Glenock

When built

1839

Class

Certificate produced

Dated 23 March 1849

By whom built

570

Owners

Wm. A. F. Morris

Port belonging to

Glenock

Destined Voyage

Port Phillip

Surveyed Afloat or in Dry Dock

Myram's Dock for defects and

Continuation

Last Survey, No.

14076

Port

London

Classed

10 A 1

REPAIRS

As the present time from premature defect in the American Oak Ceiling. The yellow Metal sheathing stripped off the whole of the beams uncovered from the keel to the upper black stroke, 3 new strokes of Ceiling on both sides above the bilges of Dunlop Oak, several new planks in fore and after body and the flat of Ceiling 9 new timbers in Starboard bow of English Oak, 4 new ditto in after body also of English Oak 3 additional Hold Beams, with their knees, new transoms across the keels of Stern timbers with 2 knees, caulked from the keel up, and sheathed with yellow Metal upon paper felt.

The upper and lower deck ~~boards~~ and comings and their bolts secured. Side plank through which they pass, the plank sheers waterways, Beams, House timbers, Knight Heads, Breast Hooks, transoms, floors, Keelsons, the planking, one side (new beams) from the keel up the ceiling the frame and inner surface of the outside plank, where it could be seen, all in good condition - the sheer is un-

Present Condition of the

attened and the keel is straight

Decks
Waterways
Comings
Upper Deck Beams & Fastenings
Lower Deck Beams & Fastenings
Planksheers
Sheerstrakes
Topsides
Wales
Plank (Bottom) and Counter

Treenails
Breasthooks and Stenson
Transoms, Pointers, and Crutches
Timbers of the Frame
Keelsons
Clamps and Shelves
Ceiling
Rudder
Copper Metal When put on 1844

Windlass and Capstan
Pumps
Boats
Masts, Yards, &c.
Sails
Anchors No. of 20/15/10
Cables
Hawsers and Warps
Standing & Running Rigging

General Observations and Opinion,

A few of the timbers of the frame as described above affected by the decayed American Oak Ceiling. The rest of the frame in good sound condition well secured and of good quality, the Beams in the Hold being originally large spaced and 3 additional Beams and she is throughout in the most efficient sound condition.

The Amount of Fee.....£ 5 : - : - is received by me,

Special..... 3 : 3 : -

Certificate (if required) : 10 : -

Committee's Minute 29th March 1849.

Character assigned Class A 1 for 3 years from 1849

for Wm. A. F. Morris
London Dock Street

and having complied with the Society's Rules before 54 is eligible to be continued 3 years.



© 2019 Lloyd's Register Foundation

LON626-0244