

arm of these beams. extending above as well as below the beam & stringer angle

Two bracket plates fitted each side connecting fore and aft stringers to bulkhead of fore peak

Three gaskets collars round stringer angles of fore peak bulkd on each side removed & renewed with new collars &c.

The breasthook plate forward re rivetted. also two bracket plates at lower part of fore peak bulkd

A number of rivets in frames at bows near fore foot removed and renewed. also in Keel & bottom in places. about 650 in all.

The fore peak Tank filled with water in order to ascertain its efficiency.

Four plates in main hold removed. in A & B strakes (20657 in A and B strakes on each side) four floor plates & frames faired & rivetted, 3 bent wash plates removed faired & refitted.

The seams & butts. caulked where necessary also around keel of stern post

The ^{iron} ceiling in main hold lifted on each side for examination of cement and replaced. & ceiling over damaged places removed & refitted Cement repaired where necessary.

The Engine and Boiler space also examined & flooring disturbed replaced.

The Rudder lifted and pulleys bushed.

Edward J. Turner.