

REPORT OF SURVEY FOR REPAIRS, &c.

Report made on 5TH FEB. 1942. When handed in at Local Office. 9/2/42 Port of NEWCASTLE-ON-TYNE
 Survey held at NORTH SHIELDS. Date, First Survey 24TH JAN. Last Survey 29TH JAN. 1942
 (No. of Visits 4)

The Wood, Iron or Steel

KIRKPOOL

Built at SUNDERLAND. By whom SIR J. LAING & SONS L^D When 1928 6.
 Owners POOL SHIPPING CO L^D Owners' Address
 (if not already recorded in Appendix to Register Book).
 Managers SIR R. ROPNER & CO L^D Port belonging to WEST HARTLEPOOL.

float or in Dry Dock? DRY DOCK. Name of Dock SMITHS DOCK CO L^D Destined Voyage ✓

Particulars of Classification (which must be inserted precisely as in Register Book & Supplements)

CHARACTER. ☒ for Special Survey. Date of last Survey and of Periodical Surveys. Machinery and Boiler Surveys (including date of N.B., if any).

+ 100 A.I. + L.M.C. 1.41.
 10.41. GRK. C.L. 6.40.
 S.S. NPT. N°3. 1-41.

Port, No. 110179. Port LON.

When held, must be reported in detail and serially in the terms of the Rules and items remaining to be surveyed should be summarised. State clearly the cause of Repairs, if any, and, in detail, the nature and extent of repairs. Repairs on account of Damage (the cause of which must be stated) should be reported from Repairs due to other causes; and besides being detailed in the body of the report, should be stated in the form shown below. Whenever the replacement of Anchors or Chains is reported the particulars should be stated in the space provided on the back of this form. State also the dates and initials of any letters in this case.

Where the Surveyor has not made a special damage report he is required to state whether he has made a special damage report for this purpose and to whom and why they were declined.

Was a damage report made by anyone else? If so, by whom? ☒ Society's Freeboard (if assigned) as painted on Ship and now verified 4 ft 9 1/2 ins.

EXAMINATION AS PER RULE, FOR 0 Reported Leakage into Boiler Room through shell P.S., stated to have been caused through encountering heavy weather whilst on voyage Leith to London on 4TH to 7TH January 1942.

Examination of bottom due to grounding - Jersey City - 5TH Dec 1941. (see New York report and interim certificate dated 6TH Dec 1941).

Vessel placed in Dry Dock, bottom snudged, cleaned, examined & recoated. approx 100 rivets (p.s.) and 60 rivets (s.s.) in Boiler Room shell frames renewed. 1 main frame in Engine Room (P.S.) fractured at the top of the T.S. Bracket. - Fracture welded out & elect. welded and bonum angle fitted.

Shell hole tested and found satisfactory - minor caulking of shell seams rivets dealt with. [P.T.O.]

DAMAGE REPAIRS:—	Shell Plates.	Frames.	R. Frames.	Floors and Bracket Floors	Beams.	Inner Bottom Plates.	Dk. Plates.	Other Items:—
Painted or Repaired								see report.
Painted in place								
ON OF THE								

Good	Bulkheads (fastened)	Good	Engine Room Skylights	Good	Copper, or Y.M. (State if on Vessel)
"	Ceiling	"	Coal Bunkers, Openings, Covers, &c.	"	When fitted, Month Year
(fastened)	Cement or Asphalt	✓	Oil Bunkers	✓	Beats
"	Rudder	Good	Scuppers	✓	Masts, Yards, &c.
of sidelights	Steering gear and its connections	"	Cargo Hatchways	Good	Condition, how ascertained (State if wedges removed)
not used	Windlass	"	Hatches	"	Equipment letter
Good	Have pumps been examined and found efficient?	✓	Planking	✓	Anchors, No. of
✓	Have Sluice Valves been examined and found efficient?	✓	Caulking	✓	Cables (State if now ranged)
✓	Have Watertight Doors been examined and found efficient?	✓	Treenails	✓	length 225 f mean diam. ✓
✓	Have Ventilators and their Coamings been examined and found efficient?	✓	Breasthooks & Stemson	✓	Rule length 270 size 2 1/16 ✓
g	Air and Sounding Pipes	✓	Transoms, Pointers & Crutches	✓	Chain Locker
examined internally?	Doubling Plates under Sounding Pipes	✓	Timbers of Frame at openings	✓	Hawsers & Warps
tested?			" " at other places	✓	Standing and Running Rigging
			Stringers, Clamps & Shelves	✓	Sails
			Sanding (State if examined.)	✓	

Observations, Opinion as to Class, Recommendation, &c.:

Clearly whether any and, if so, what alteration is suggested to be made in the existing classification and notification of the vessel in the Register Book consequent upon repairs, thus, for example:— "to remain as classed in the Register Book without fresh record of Survey," "to remain as classed and to have record of survey, 1,38, and the notations of ss No. 1-38."

Vessel, so far as now seen, is in good condition and eligible in my opinion to remain classed and to have fresh record of Dry Docking 1.42. subject to indentified shell plating (p.s.) being permanently repaired at the first convenient opportunity. (1 Bower anchor + 45 fathoms of cable to supply).

Fees applied for. 10 FEB 1942
 Received by me, 19

Minute FRI. 20 FEB 1942

Assigned 1000A1 subject P.S. 1.42

G. Young
 Surveyor to Lloyd's Register of Shipping.



© 2020

Lloyd's Register Foundation

W275-0081

