

COPY. Condition Survey

# Lloyd's Register of Shipping.

86



Port NEW YORK

JUNE 20, 1940

CLASSIFIED - L. R. C-1897  
CLASSIFIED - AB

This is to Certify that

J. W. BELTON

the undersigned Surveyor to this Society did at the request of

The British Ministry of Shipping examine the S.S. "WEST CAWTHON" 5611 tons gross register of New York while the vessel was hauled out on dry dock at the Bethlehem Steel Company's Hoboken Plant on June 18th, 1940 and subsequent date for the purpose of reporting upon the vessel's underwater condition.

FOUND I have examined in the Committee of Lloyd's Shell plating, rudder and propeller in good condition with the following exceptions:

- Shell plating wasted in way of boiler blow down valve and at forward corners of main injection sea chest.
- A number of rivets leaking in Port and Starboard tuck plates and a small crack in Port tuck plate.
- Several shell rivets in way of deep tank and after peak tank leaking.
- Bounding angles, Port and Starboard, in Forward bulkhead of deep tank leaking.
- Welding of fairwater plates on rudder cracked.
- Rudder plate cracked in way of upper arm and a number of rivets loose.
- Welding at edge of after keel plate on stern frame wasted.
- A number of loose rivets in bilge keel.
- First shell frame Starboard side aft of No. 2 hold forward bulkhead fractured on inner flange.
- Propeller wedge 3/16 inch.

NOW DONE

- Boiler blow down valve removed, shell plating built up by welding and valve refitted.
- Shell plating at forward corners of main injection sea chest built up by welding.
- All leaking rivets in shell and bounding bar of deep tank caulked and made tight.
- Cracked rudder plate, port and starboard tuck plates and fairwater plates electrically welded, now good. Welding at after end of after keel plate renewed.
- Loose rivets in bilge keel and rudder arm renewed.
- Shell frame in No. 2 hold electrically welded.

\$50.00

This Certificate is issued upon the terms of the Rules and Regulations of the Society, which provide that:

"While the Committees of the Society use their best endeavours to ensure that the functions of the Society are properly executed, it is to be understood that neither the Society nor any Member of any of its Committees is under any circumstances to be held responsible for any inaccuracy in any report or certificate issued by the Society or its Surveyors, or in any entry in the Register Book or other publication of the Society, or for any error of judgment, default or negligence of any of its Committees or any Member thereof, or the Surveyors, or other Officers or Agents of the Society."

COPY

Register of Shipping

1940

1940

1940



Lloyd's Register Foundation

1940

to report the bill of lading of the cargo

the bill of lading of the cargo of the vessel

for the bill of lading of the cargo of the vessel

the bill of lading of the cargo of the vessel

the bill of lading of the cargo of the vessel

the bill of lading of the cargo of the vessel

the bill of lading of the cargo of the vessel

Refer to the Chief Ship Surveyor

Mr. Stadden to note

1940

1940

00-034

1940-020

101