



"Pencelva"

Part boiler, Six plain tubes renewed, Two stay tubes have been renewed from lower portion of centre tube plate and solid stays with nuts & washers both sides of tube plates fitted in order to stiffen tube plate.

At the Owners request three stiffening plates have been fitted to each furnace jacked up (see sketch) It is not known what caused these furnaces to become distorted.

On completion of repairs boiler tested under hydraulic pressure with satisfactory results

Miller Staiton



© 2020

Lloyd's Register Foundation

W 481 - 00 48(2/2)