


MINDEROO. — Broome, Sept. 17. —
Steamer Minderoo: Master advises
vessel now seaworthy towage to Singa-
pore (from Port Hedland) no further
repairs necessary, engines disabled
totally. Awaiting instructions from
Perth, W.A., arrangements for towage.
—Lloyd's Agent per Salvage Associa-
tion.

MINDEROO.—Port Hedland, Sept. 21.—
Steamer Minderoo: Following informa-
tion is from master and subject to sur-
veyor's report: Tank top and bottom
set up one foot for a length of 30 feet
under thrust shaft, floors badly set up,
shaft bent first tunnel bearings to third
main bearings, engine bed plate broken,
low pressure cylinder one foot higher
high pressure cylinder, other minor
damages. Cracked main injection
inlet casting repaired temporarily.
Vessel making no water. Auxiliary
engines running. Accident caused by
vessel settling down on bank amidships
causing buckling. Lloyd's Register Sur-
veyor due to arrive on Sept. 25.—
—Lloyd's Agent, Broome, per Salvage
Association.

MINDEROO.—Port Hedland, Sept. 27.—
Steamer Minderoo has been surveyed
by the Surveyor to Lloyd's Register
and found perfectly seaworthy. Sur-
veyor reports her to be in a fit condi-
tion to be towed to Sourabaya and
Singapore. Surveyor's opinion is that
she can proceed with safety with one
tug, including leaving the harbour. No
further damage found than already
reported with exception of plates bent
or buckled in five strake port and star-
board sides in way of No. 3 hold.—
Lloyd's Agent, Broome, per Salvage
Association.

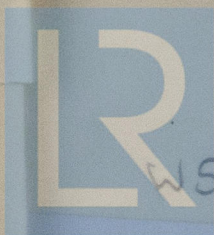

© 2020

Lloyd's Register
Foundation

W537-0266