

of writing Report Jan 15th 1925 When handed in at Local Office Jan 15th 1925 Port. of Bristol
in Survey held at Gloucester & Sharpness Date, First Survey Jan 6th Last Survey Jan 12th 1925
Book. on the River of the Bristol (No. of Visits) 3

TONNAGE: - 272
GROSS 272
ORDER DE. 206
T 120

Built at Glasgow By whom Harland & Wolff, Ltd. When 1924-11
Owners British Mexican Petroleum Co. Ltd. (A. Weir & Co. Mgrs.) Port belonging to London
Owners' Address
(If not already recorded in Appendix to Register Book).

Surveyed Afloat or in Dry Dock?	Name of Dock	Channel	Destined Voyage
B=CellDBorDBa	feet; uE&B	feet; f	feet; }
al capacity tons; FPT	tons; APT	tons; MT	feet tons
Particulars of Classification (which must be inserted)			

<p>If the Vessel has Water Ballast Tanks, state whether the manhole covers have been removed, and the insides of the tanks examined. Also state the amount of deterioration (if any) found in the thicknesses of the floors, framing, and of the inner bottom plating, especially in the boiler space.</p>		<p>CHARACTER. <input checked="" type="checkbox"/> For Special Survey. <input type="checkbox"/> Date of last Survey and of Periodical Surveys.</p>		<p>Years Assigned now required.</p>	<p>Machinery and Boiler Surveys (including date of N.B., if any).</p>
<p>1st Report, No. 12022 Port Son</p>		<p>\$100A 11-24</p>		<p>5</p>	<p>11-24</p>

...sual Surveys, when held, must be reported in detail and seriation in the terms of the Rules. State clearly the repairs, if any, and, in detail, the nature and extent of Examinations and subsequent repairs. Repairs (the cause of which must be stated) should be separated from Repairs due to other causes; failed in the body of the report, should be summarised in the form shown below. Whenever the Riggers or Chains is reported, the particulars should be clearly stated in the space provided on the form. State also the dates and initials of any letters respecting this case.

ed? *Interviewed* Was a damage report made by anyone else? If so, by whom?

AMINATION AS PER RULE, FOR foundation & Heavy weather whilst on
from Hawley to Gloucester, grounding & striking the quay wall
Nov. Dec 27th. Also Dec 15th. striking N^o 1 bridge of Gros' Canal
Halls in dry dock. Bottom & rudder cleaned. Irons & cleats
is. C.T. 4, 5 & 6 unseated & a grain's landings. Riveting & caulking
found in run. These plates will be ^{repaired} & repaired at the main
which in my opinion is satisfactory. Clutch arm & Ste.
armature temporarily repaired. This will be renewed at Southampton
fathom of cable & Ste.^s lower anchor plates lost replaced. The
anchor has been coupled up on the Ste.^s side as a temporary measure

REPAIRS:—	Plates.	Frames.	R. Frames.	Floors.	Beams.	Str. Plates.	Dk. Plates.	Other Items:—
... ..								
Red or Repaired	✓	✓	✓	✓	✓	✓	✓	✓
Red in place								

OF THE		Name of Vessel		Date of Examination		Name of Examiner	
State if Tanks have been examined inside	Yes	Dbing. Plates under Sounding Pipes	Yes	Copper, or Y.M. of Wood Vessels	(State if on Fell)	When put on, Month	Year
State if Tanks now tested	Yes	Engine Room Skylights	Yes	Boats	Good		
Bulkheads	Interruption	Coal Bunkers, Open'gs, Lids, &c.	-	Masts, Yards, &c.	-		
Ceiling	-	Scuppers	-	Condition, how ascertained	from all		
Cement or Asphalt	Yes	Cargo Hatchways	-	(State if wedges removed)	-		
(State which.)	Yes	Rudder	-	Sails	-		
Rudder	Good	Hatches	-	Equipment letter	1		
Steering gear and its connections	Interruption	Planking	of Wood Vessels	Anchors, No. of	1315		
Windlass	-	Caulking	ditto	Cables (State if now ranged)	Yes		
Have Pumps now been examined and found efficient?	-	Treenails	ditto	length	✓	size	
Have Sluice Valves now been examined and found efficient?	-	Breasthooks & Stemson	ditto	(on board)	✓	size	
Have Watertight Doors now been examined and found efficient?	-	Transoms, Pointers, & Crutches	ditto	Rule length	✓	size	
Have Ventilators and their Coamings been examined and found efficient?	-	Timbers of Frame at openings	ditto	Hawser & Warps	Good		
		Ditto ditto at other places	ditto	Standing & Running Rigging	-		
		Stringers, Clamps & Shelves	ditto				
		Salting	ditto				
		(State if examined.)					

Observations, Opinion as to Class, Recommendation, &c.:—

clearly whether any and, if so, what alteration is suggested to be made in the existing classification and notification of the vessel in the Register Book consequent upon
thus, for example:—".....to remain as now classed in the Register Book *without fresh record of Survey*," "to remain as classed and to have record of
"or "to remain as classed and to have record of survey, 1, 15, and the notations of ss No. 1-15 and ptnD15, &c."

my opinion to remain as classed & to have record of survey 1-25
at 1000 fathoms & 15 fathoms of cable being supplied & windlass repaired
assumption & on anchor plate on the starboard side to be repaired at Boston

Repair Fee (if any) \$ 5 : 5 : 0 Jan 13 1925.
 Fee (if chargeable) \$ 2 : 4 : 4 Received by me, Jan 20 1925.
 Fee (if any) \$

John W. Ensign
 Surveyor to Lloyd's Register of Shipping.

tee's Minute
ter Assigned
10001 Subject
Larr: pet: in milk
Filled for oil fuel
W632-0044