

WILLEMSTAD, CURACAO, D.W.I.

June 20th, 1930.

A. Cannon, & E.S. Whitham

s

Agents. Curacaoische Scheepvaart Maatschappij, attend on board the
S. "RIMULA", 577 Gross Tons, of London, in order to ascertain
and determine as to the nature and extent of the damage stated
to have been sustained through stranding on the South East corner
of Curacao on May 27th, 1930, while on a voyage from Curacao to
San Pedro de Macoris with a cargo of case oil.

For further information see Log Book and Protest.

The vessel was refloated on June 15th, 1930 and placed on the
blocks of the Juliana Drydock that same day.

On June 16th, 1930, and subsequent dates, the Undersigned made
examination, as far as was practicable, and;

FOUND RECOMMENDED
Damage numbered from Forward. Shell plates numbered from Aft.

PORT SIDE

Shell plates badly indented.	To be renewed A1; A2; A3; A4; A5; A7; A9; A10; A11; B2; B3; B4; B5; B8; B9; B11; C3; C4; C5; C6; C7; C8; D4; D5;.
Shell plates indented.	To be taken off, faired and replaced; A6; A8; B1; B6; B7; B10;.
Shell plates slightly indented.	To be faired in place; C2; C9; C10; C11;.



© 2020

Lloyd's Register
Foundation

de frames badly distorted in way of bilge. To renew Nos.66; 67; 68; 69; 70; 81; 82; 83; 88; 89;.

de frames distorted of bilge. To be removed, faired and replaced Nos.47; 48; 49; 50; 71; 72; 73; 74;.

de frames slightly d. To be faired in place Nos.2; 3; 4; 5; 6; 7; 8; 9; 24; 25; 26; 41; 42; 51; 52; 75; 76; 77; 78; 79; 80; 87;.

otton frame angles distorted badly. To be renewed Nos.19; 20; 21; 22; 23; 27; 28; 29; 30; 31; 32; 33; 34; 35; 36; 44; 45; 46; 47; 48; 49; 55; 56; 57; 58; 59; 60; 61; 62; 63; 64; 65; 61; 82; 83; Deep floors 88; 89; Intercostals to be renewed as necessary.

otton frame angles d. To be removed, faired and replaced Nos.24; 25; 26; 39; 40; 41; 42; 50; 51; 52; 53; 54;.

gin plate brackets d. To be removed, faired and replaced Nos.47; 48; 49; 50;.

ge keel badly To be renewed 54 feet.

STARBOARD SIDE

ates badly indented. To be renewed A1; A2; A9; A10; A11; B1; B3; B4; B9; B10; B11; C3; C4; C5; C8;.

ates indented. To be removed, faired and replaced A8; B5; B8;.

ates slightly To be faired in place A3; A5; B2; B6; C2; C6; C9;.

de frames badly d. To be renewed Nos.88; 89;.

de frames distorted of bilge. To be removed, faired and replaced Nos.4; 13; 76; 80;.

de frames slightly d. To be faired in place Nos.2; 3; 5; 6; 9; 10; 11; 12; 66; 67; 68; 69; 70; 71; 72; 73; 74; 75; 77; 79; 81; 82; 84;.

otton frame angles distorted. To be renewed Nos.20; 21; 23; 24; 61; 62; 63; 64;.


otton frame angles d. To be removed, faired and replaced Nos.18; 19; 22; 25; 26; 56; 57; 58; 59; 60;.

rd bilge keel badly To be renewed 27 feet.

started after Peak bulkhead. To be re-riveted.

started in boundary fore peak bulkhead. To be re-riveted.

between No.2 double tank and cofferdam To be faired and re-riveted as necessary.

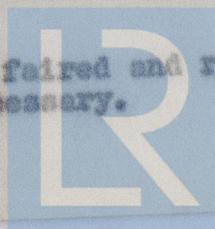

© 2020

Lloyd's Register Foundation

- bar Forward broken. To be renewed forty feet.
- bar Aft broken and ported. To be renewed twenty feet.
- in frame broken, rudder and sole piece missing. To be renewed.
- er carried away at ling to extension piece. To be renewed.
- allier, all blades damaged. To be renewed.
- in tube slack in stern To be removed and renewed if necessary and tail shaft to be tried for true.
- on Fo'castle deck ing spars/and three sections of same damaged. To be renewed.
- ard on starboard side castle deck broken. To be renewed.
- rail on starboard side Fo'castle deck broken. To be renewed.
- ilator on starboard side Fo'castle deck broken. Deck head plate to be faired in place and ventilator to be renewed.
- planking of Fo'castle k damaged. To be renewed as necessary.
- rboard spirketting plate aged. To be faired in place.
- ing gear of windlass ed. Windlass to overhaul.
- ches of after cofferdam aged. To be renewed.
- nel stays slack. To be overhauled.
- ing to Fore mast head at damaged. To be repaired.
- lifeboat lost. To be replaced.
- life boat damaged. To be repaired as necessary.
- life boat davit starbd. To be renewed.
- deck damaged. To be renewed, faired and replaced.
- life boat davit slightly aged on port poop deck. To be renewed.
- of two wash ports aged. To be renewed.
- ases of side lights in w quarter forward broken. To be renewed.
- ine telegraph leads aged. To be overhauled.
- ring gear leads and tter springs. To be overhauled.
- in hatch covers gaskets aged. To be overhauled.



© 2020

Lloyd's Register Foundation

W643-0194 (3/4)

red and twenty
of 2 1/2 inch Manila

To be renewed.

of two inch wire

To be renewed.

Recommended that; Engines, Auxiliaries, and Boilers be
to facilitate repairs and that same be opened up for
ion; Master, officers and crew accomodation be restored
good condition as previous.

500.00

Alexander Common & E. S. Whitham
SURVEYORS TO LLOYD'S REGISTER,
CURACAO. D.W.I.



© 2020

Lloyd's Register
Foundation