

L. J. Harrison Thru


Kob 3815.

With regard to the surveyors recommendation that the after liner should be renewed & the joint stepped, dovetailed & caulked with a copper strip, it should be pointed out to him that experience shows this type of joint is never permanently satisfactory & the joint, if made, should be burned completely through as required by the rules. see para 3 section 11 page 73 of the Rules.

It should also be pointed out to him that the diameter of the shaft as originally fitted is not sufficient for a shaft with two liners

Inv. 13737-23

L.  
8/3/23.

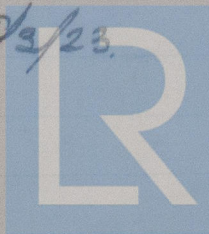

© 2020

Lloyd's Register  
Foundation

W667-0027