

by Chief Ship Surveyor

Received from Chief Ship Surveyor

EL'S NAME Steel 5 mst. Bk. "FRANCE"

Rpt. Lon.

No. 85266

Remarks of the Chief Ship Surveyor are desired on this case for the consideration of the Classing Committee.

("The endorsement to contain a succinct summary of any repairs that have been required and to show the cause or causes of such repairs, and also to bring out clearly any exceptional features in connection with the case, so that the Classing Committee may have all the salient points presented in the endorsement."—Extract from Sub-Committee's Report, 24/5/92.)

of Survey

The London Surveyors report this vessel placed in dry dock, the riveting and caulking overhauled, bottom cleaned and coated.

Damage through stress of weather, the foremost plates of 2nd, 3rd and 4th stringers below tank top in fore peak found fractured, repaired as follows:— Port side 2nd and 4th stringer plates cropped and part renewed, brackets, beam and shell connections re-riveted as necessary. Starboard side the 2nd and 3rd stringer plates doubled and 4th stringer plate cropped and part renewed, and riveting in way made good. One breasthook renewed, one panting beam repaired and minor repairs effected.

It is submitted the vessel appears worthy to remain as classed with fresh record of survey.

100 A. 1  
2. 22 Lon.

M

20. 2. 22.



© 2020

Lloyd's Register  
Foundation

W711-0168