



18. B.—If this Report is copied by Copying Press, special care must be taken that the copying paper is not so much damaged as to spread the ink, or to cause it to show through to the other side.


Flat Keel, No 2 from stem has been faired in place, No 3, 4, 5 & 6 have been removed, faired & refitted. A stroke, No 3, 4, 5, 6 & 7 on P.S. & No 4, 5, 7 & 9 on S.B. have been removed, faired & refitted. No 3 & 6 on S.B. side have been faired in place. B stroke, No 4, 5, 6 & 7 on P.S. & 3, 4, 5 & 6 on S.B. have been removed, faired & refitted. No 3, & 10 on P.S. & 7, 8 & 9 on S.B. have been faired in place. C stroke, No 4, 5 & 6 on P.S. & No 2, 3 & 4 on S.B. have been removed, faired & refitted. No 1, 2 & 3 on P.S. & No 5 on S.B. have been faired in place. D stroke, No 7 & 8 on P.S. & No 3 on S.B. have been removed, faired & refitted. No 5, 6 & 9 on P.S. & No 5 & 6 on S.B. have been faired in place. E stroke, No 4 on S.B. has been faired in place. F stroke, No 4 & one plate at least. No 3 halfway on S.B. side have been faired in place. 36 floors & frames each side with intercostals have been faired & repaired of which 7 floors & 11 frames on S.B. & 10 floors & frames on P.S. have been removed & faired.

ANCHORS.

\_\_\_\_\_

## CHAIN CABLES.

...



Lloyd's Register  
Foundation