

22<sup>nd</sup> March 1848

Francis Donblon

The Chief Agent repairs on board  
the Eng. Ste. Vedellard <sup>2150</sup> tons whilst  
at anchor at the river Chocoma side of this Port,  
to hold a survey on the first intermediate  
shaft abast the thrust shaft, in order to  
ascertain its efficiency for the vessel to pro-  
ceed on her intended voyage to Philadelphia  
and return.

On examination found in the upper part  
of the said shaft a flaw 14" long of which a  
Central longitudinal portion ending both  
sides diagonally in very close traces the  
upper one at a short distance from the journal.

The flaw extending to the opposite side  
for a length of about five inches, is to all  
appearance due to an homogeneous weld.

The undersigned, after the above flaw  
has been marked both ends with a Centre  
punch recommended this defect to be  
secured

secured with a Casted Steel clamp, in  
two halves, 24 inches long fitted  
with eight Steel bolts 2 1/2" diam which  
was done and found satisfactory.



© 2018

Lloyd's Register  
Foundation