


COPY. PORT OF

S. S. "BENGKALIS"

| | |
|--|------------|
| M.P. piston and cylinder examined. | Feb. '41. |
| " piston-rod stuffing-box (U.S. and Jacobs packing) | Dec. '40. |
| " bottom end and crank pin. <u>B.V. surveyor.</u> | May. '40. |
| " guide-shoe renewed. | Jan. '41. |
| M.P. piston and cylinder. <u>B.V. surveyor</u> | Sept. '40. |
| " piston-rod stuffing-box (U.S. and Jacobs packing) | Aug. '40. |
| " bottom-end and crank pin. <u>B.V. surveyor</u> | May. '40. |
| " slide-valve rod stuffing-box. (U.S. & Jacobs packing) | Jan. '41. |
| M.P. piston and cylinder. <u>B.V. surveyor</u> | Sept. '40. |
| " piston-rod stuffing box (U.S. packing. | Aug. '40. |
| " bottom end spare part fitted, and white metal renewed. | Dec. '40. |
| " slide-valve rod stuffing box. | Dec. '40. |
| Crank-shaft examined with Lloyd's gauge. | Sept. '40. |
| Foundation --bolts examined | July. '40. |
| Thrust block and shaft. <u>B.V. surveyor.</u> | Sept. '40. |
| Tunnel-shaft and bearings <u>B.V. surveyor.</u> | " '40. |
| Stern shaft and bush. <u>B.V. surveyor.</u> | |
| (lignum vitae renewed) | May. '40. |
| Starting engine, crack in bed-plate repaired. | Dec. '40. |
| " " overhauled. | Dec. '40. |
| Circulation engine (foremost) piston and slide-valve. | Dec. '40. |
| " " (hindmost) overhauled. <u>B.V. surveyor.</u> | May. '40. |
| Centrifugal pump brasses renewed. <u>B.V. surveyor</u> | " '40. |
| Bilge-pump (main engine) valves and seats. | Dec. '40. |
| Clark Chapman Feed pump (foremost) overhauled. | Jan. '40. |
| Turbin feed pump, turbine overhauled. | July. '40. |
| " " L.P. pump controlled. | Jan. '41. |
| Condensing water-pump, valves and seats. | Dec. '40. |
| Ballast pump overhauled. <u>B.V. surveyor.</u> | Sept. '40. |
| San. Pump overhauled. <u>B.V. Surveyor.</u> | May. '40. |
| Freshwater pump valves and seats. | Nov. '40. |
| Evaporator, bottom blow off cock, plug renewed. | Nov. '40. |
| Fan engine overhauled (SB) <u>B.V. surveyor.</u> | Sept. '40. |
| " " " (GB) | Feb. '40. |
| Refrigerating engine, overhauled. | Aug. '40. |
| Brine pump, pump part overhauled. | Feb. '41. |
| Dynamo generator overhauled | March '40. |
| " engine governor renewed and piston and slide valve exam. | Jan. '41. |

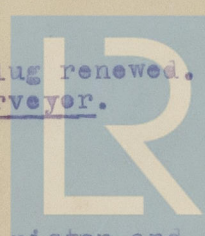

© 2020
 Lloyd's Register
 Foundation

002374-002384-0079 1/2

... of ... in the ... Register
 The Completion of The General Examination

COPY. PORT OF

Voltmeter renewed.

Jan. '41.

All boilers B.V. surveyor.

June. '40.

Safety valves, both aft boilers and SB foremost.

Jan. '41.

All steam valves overhauled.

May. '40.

All cocks of watergauges overhauled.

Dec. '40.

All bottom blow of cocks.

Dec. '40.

Foremost Weirs fuel pump overhauled, 4 piston rings
(steam) renewed.

June. '40.

Hindmost Weirs fuel pump overhauled.

Oct. '40.

B.B. Sabree refrigerating engine overhauled and
preserved.

April. '40.

S.E. " " " " " "

May. '40.

Ash-sheet closed with a plate on the hull

Jan. '40.

Lloyd's Surveyor Vancouver

S.B. bunker cleaned, drainoff pipes from deck
renewed.

Dec. '40.

Steering engine.

Regulating valve chest bored and slide-valve
renewed.

Turning parts of the valve movement fitted.

Aug. '40.

Guide-bush of regulating valve-red renewed.

Dec. '40.

Screwed bars of the telemeter renewed, now 1"

Dec. '40.

Bridge telemeter leather rings renewed

Dec. '40.

S.B. seat of working-axe at Seerabaja renewed.

May. '40.



© 2020

Lloyd's Register
Foundation

002374-002384-0079 2/2

ard (if assign
ip and now v

hom?

am h

ma

chiall

Venn

Oct. '40.

T. Su

Sum

peak

10m

ier M

as M

ms :-

ms :-

ms :-

ms :-

Copper, or Y.M.

(State if on

When fitted, Mont

Boats

Masts, Yards, &c

Condition, how as

(State if wed

Equipment letter

Anchors, No. of

Cables (State if n

„ length

(on bo

„ Rule length

Chain Locker

Rawlers & Warp

Standing and Run

Sails

in the Register

main as classed

State

Umm