

RETAIN FOR FUTURE USE.

M.S. HAUKEFJELL

N/N Bluenwater

Summary of surveys and 5·44.

Swansea Rft No 102259 5·44.

Examination afloat following grounding off Swansea 5·5·44 and annual survey.

New York Rft No 103455 6·44.

Repair to damage caused by grounding at Scovina. Collision repair in F.G.H.J.K.
+ deckstays std to be carried out at owners convenience.

New York Rft No 120187. 8·44

Annual Survey.

Baltimore Rfts Nos 111998/9 + 112000/1/2/3 4·45.

Dry docking + several tanks tested.

Repair effected to shell aft - the damage was caused by striking a submerged
jetty at Paris on 7·11·44

Repairs effected to collision damage caused at Barry 7·3·43.

Heavy weather damage repairs.

Repair effected to damage caused by collision in a French port 11·3·45

" " " " " striking her in London 9·1·45

Suez Rft No 112004 6·45.

Seaworthy certificate after examination afloat consequent on grounding 1·6·45.

Melbourne Rft No ~~112005~~ 106746 10·45.

Off ^{afloat} Leaking nuts in engine room web frame p.s. replaced by bolts.
Permanent repair to be effected at next dry docking, also examination for
damage due to grounding on voyage Port Said to Suez 1·6·45.

Melbourne Rft No 112005 12·45

General examination afloat - bolted work in E.R. in good order.

Glasgow Rft No 109400 4·46

Special Survey type 1. Yellowing shell repair outstanding.

A stroke (p) No 2 forecastle to be fairied in place, nuts to be hardened + rears to
C removed, fairied + refitted.

A - - (s) Nos 1-2-3. closed - to be filled with welding

B - - Nos 1-2.

to be fairied in place.

B - - - No 2

to be removed fairied + refitted.

G - - - above G-7.

released + fairied in place.

Annual Survey carried out.

Go factors of cable to supply.

0024472-002448-0223

© 2021

Lloyd's Register
Foundation

9. Port Said Rpt No 118374 8.46

Seaworthy certificate afloat after collision damage off Aden 16.7.46.

Damage to fore end (f.s.) in way of anchor also slight damage starboard side. Repairs deferred until return to Port Said

10. Antwerp Rpt No 111481 1.47.

Fore end damage repaired. Port shell plate C 2 together with adjacent B. strake set up in two places. Release + Fair in place at owners convenience. C. 3 (f) set up. F.I.P. at owners convenience.

11. Houston Rpt No 111768 2.47.

Heavy weather repair. Temporary repair effected in E.R. Rivets in one longitudinal replaced by bolts. Cement base fitted 2nd strake above T (h 4) between 1st & 2nd transverse from A.P. bhd. Recommend shell to be examined at next drydocking + above shell plate to be drilled.

12. Suez Rpt No 113234 6.47

Seaworthy certificate afte examination afloat after grounding ^{wing}. Examination by diver revealed shell plates set up in way No 1, f.s. + bilge keel forward buckled 20'. To be checked on completion of voyage.

13. Rotterdam Rpt No 114621 10.47.

Bottom damage. forward repaired + engine room web frames refore. Annual Survey carried out.

14. Hull Rpt No 117920 3.48.

Annual Survey carried out.

© 2021



Lloyd's Register
Foundation