

Received from Chief Ship Surveyor

20 MAR 1957

SHIP'S NAME

"IRENE M"

REPORT

Mtl. No.

11513

GB

Subject to indented shell plating etc. on  
Outstanding Conditions of Class: port bow and to shell plates B.14, E.5 (s.s.),  
D.11, F.6, G.3 & 4 (p.s.) being renewed by completion of the S.S.  
by 1,57, and to 15 fathoms of chain cable (s.s.) (supplied Mtl. 12,56)  
being verified with test certificate at the earliest opportunity.  
ACTION is DEFERRED for S.S. by 1,57 and for  
examination in dry dock after ice damage.

Endorsement of Class (B) (As before ~~xxx None~~)

Surveys due: SPECIAL SURVEY (C) due 4,56 - commenced Mtl. 10,56 and  
subsequently advanced.

Nature of Present Survey: (Afloat ~~and in dry dock~~)

Temporary repairs on account of leakage stated caused by ice damage

Special Features: The year of grace expired 4,57.

Is Interim Certificate in order (Yes-No-None)

~~Items Outstanding: (if any for S.S. or A.S.)~~

FOR PORTION OF SURVEY HELD:- See Mtl. Rpt. No. 11377.

S.S. to be completed by:

Recommendation:

SUBMITTED ACTION continue to be DEFERRED for  
completion of Special Survey and for drydocking  
(ice damage), subject as above, and to permanent  
repairs to side shell plating in way of No.1 hold  
(s.s.f.) also to deck plating in way of aft end of  
Ni.2 hatchway (p.s.) and forward end of No.4 hatchway  
on ship's arrival at Montreal from present voyage,  
with Endorsement of Certificate.

As Now. Subject

S.S. PART HELD.

ENDORSEMENT OF CERTIFICATE.

Indents in tunnel plating and shell plate

No.2 from aft in 1st below sheer (p.s.).

Side shell plating No.2 hold (p.s.) slightly set in.

OFFICE NOTE

Service limits to be deleted on receipt of a  
satisfactory Report 8 on completion of S.S.

IN S.R.L.

Drydocking (ice dam.)

Blk(new)

001647-00652-0100

© 2021

Lloyd's Register  
Foundation