

Glasgow 1601

 
LAKE FREEBOARDS

Alterations Required In Order To Comply
With
Conditions of Assignment

SS "FAIRMOUNT"

 
- ✓ Forecastle Bulkhead - 1-1/4" panel wood doors, should be plated or should be replaced by steel doors.
- ✓ Forecastle - Missing hinged covers on sidescuttles should be replaced.
- ✓ Hatch beams; existing fore and afters are considerably substandard and require to be reinforced thus:-

Nos. 1 to 5 hatches (12 ft.)

✓  5 1/2" x 1" plate

X Or replace by any of these
Standard I beams - $\begin{cases} 3 @ 10" \times 4 \frac{5}{8} \times 35\# \\ 3 @ 12" \times 5 \times 31.8\# \\ 3 @ 10" \times 5 \frac{1}{4} \times 29\# \end{cases}$

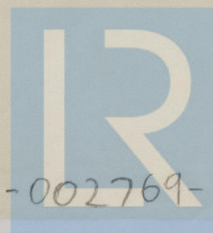
No. 6 hatch (14 ft.)

✓  7 1/2" x 1" plate

X Or replace by Standard I beams -
 $3 @ 12" \times 5 \frac{1}{4} \times 40.8\#$

- ✓ Missing chafing plates on wood thwartship beams to be replaced.
- ✓ Vents and airpipes - means of closing to be provided.
- ✓ Lifelines - to be provided.

See Montreal report dated Aug 12, 1941



© 2021

Lloyd's Register
Foundation

002762-002769-0037