

Received from Chief Ship Surveyor

3 JUL 1958

NAME

"CEDARPOOL"

REPORT

Vcr.

No. 10348

ing Conditions of Class: Subject to indented shell plates in 'G' & 'H' takes in way of frs. 112/3 (s.s. from aft) and top edge of sheerstrake s.a.) being examined and dealt with as necessary, also to hawse (p.s.) (Metalock repaired 5,56 & doubled 4,58) and wavy er deck plating amidships (p & s) being specially examined and dealt h as necessary next Special Survey.

ment of Certificate (As before ~~or Nonex~~)

of Present Survey: (Afloat and in dry dock)

docking: Temporary and deferred repairs effected to corroded bottom shell plating: pairs effected to rudder pintle.

ndation:

SUBMITTED record of 'DS 5,58' be assigned as recommended, subject as above, and to wasted bottom shell plating in way of cofferdam frs. Nos. 69/70 (doubled 5,58), being permanently repaired and to rudder top pintle and No. 7 D.B. tank top plating (s.s.) being specially examined and dealt with as necessary at ~~next~~ Special Survey.

5,58 Subject *the*

L. APPENDIX NOTE

11 plate E.2 (p.s.f.) indented.



© 2020

Lloyd's Register
Foundation

007997-003005-0064

17 JUL 1958

Received from Chief Ship Surveyor

No. 10348

Ver.

REPORT

"CEDARPOOL"

ME

It is reported that this ship is proceeding direct to a U.K. port where the Special Survey will be carried out - Special Survey (C) due 6,58.

IT IS FURTHER SUBMITTED the VANCOUVER Surveyors be requested to advise this Office the nature deferred repairs to No.7 D.B.tank top (s.s.) as this item has not been reported in the body of the report.

X

16
10/58



© 2020

Lloyd's Register
Foundation