

4E

19 FEB 1958

Received by Chief Engineer Surveyor..... Received from Chief Engineer Surveyor.....

SHIP'S NAME CASSIAN SEA REPORT Rot No. 44821

CS Advanced.

DBS due 12.57, partly held now.

Docking.

The Surveyor reports Nos. 1 and 2 main engine cylinder covers found cracked in way of the starting air pockets and recommends these covers be specially examined before the end of July 1958 (6 months limit).

Also, the inboard generator governor was found not working, and the Surveyor recommends the foregoing be repaired and examined under working conditions before the end of July 1958 (6 months limit).

The Surveyor reports all propeller blades were found wasted and thin at the edges and recommends the blades be specially examined and dealt with as found necessary at the next drydocking.

ADDITIONS. A new emergency fire pump has been fitted in the forward cargo-hold and the sea suction for the pump has been fitted in the forward Pump Room

A Special Survey became due in 12.57 and postponement until 12.58 approved providing a satisfactory General Examination carried out.

The Surveyor reports a satisfactory General Examination has been held in accordance with Circular No. 1959, also the CS considerably advanced at this time.

IT IS SUBMITTED this vessel is eligible to remain as classed with fresh record of DBS 1.58 when the survey has been completed as per this report, subject as recommended.

See endorsement dated 18 JUL 1958
for completion DBS
✓



© 2021

Lloyd's Register

17.2.58. 003023-003028-0196

Foundation