

20 MAY 1944

Port of

Southampton

Nov 10th

1943

REPORT ON MASTS, SPARS, AND RIGGING.

Having, in accordance with your instructions,
examined the Masts, Spars, Iron Work of same, and Rigging, of the

Name of Vessel

M. V. Winestehine

on the (Date of examination)

November 10th

1943

I have to report that I found Foremast lower rigging requires renewal.

Foremast-barkstays requires renewal. Rigging main + shrouds good.
Mainmast rigging good condition except Starboard lower
snifter shroud which requires renewal.

Rigging main + shrouds good.

MAST. Gaff requires new Heel Fitting; Derrick Topping Lift Larks to renew; Derrick
Heel Fittings to make workable; Mast Head Block Fittings to Renew.

MAST. 1. Derrick Topping Lift Link to renew; Derrick Heel Fittings to make workable;
2. in Bracket to carry Bell badly worn + requires building up by welding, also
3. inside Bell, and blapper needs renewing; Approximately 30 FT Iron Ladder
bad condition, needs renewing; Overall patch 6" x 5" required to cover spot sealed
4. in lower part of Upper Irons test.

Fee £

:

A. G. Putter's

To the Surveyors,

Lloyd's Register of Shipping,