

Ship's name "ETTRICKBANK"

Port RGN.

No. 06331

Last survey date 1.10.62.

Ship is subject to indented side shell plates J.8, H.8 and G.6 (p.s. from aft), indented bottom shell plates A.15 & 16, B.15 & 16, C.16 (s.s. from aft), also upper deck plating (p.s) and fwd. bulkhead of deep tank (p.s) (fire damage) being specially examined and dealt with as necessary by the S.S., to permanent repairs to side shell plates 9 & 10 (p.s. from aft), to indented shell plates G.12 and H.13 (p.s) being specially examined next drydocking. ACTION is DEFERRED for R.L. Appendix (as before or none) Special Survey, by 10.62.

Surveys due

SPECIAL SURVEY (D) due 7.61. *to a lower anchor & 3 lengths of c.c. Supp. supplied at the earliest opp.* Postponement until 7.62 approved 28.6.61 and the necessary G.E. held in Cal. 1.62. Owners request for further postponement until 10.62 approved 18.5.62 provided Surveyor satisfied as a result of a G.E.

Structure of present survey (afloat and in drydock)

Temporary repairs to wasted shell plate H.10 in way of starboard deep tank.

Interim certificate in order

Yes/No/None

Items outstanding if any for SS

ALL ITEMS.

Proposed to be completed by 10.62.

Recommendation SUBMITTED ACTION continue to be DEFERRED for Special Survey by 10.62, subject as above and to wasted shell plate H.10 in way of starboard deep tank being examined and dealt with as necessary by the Special Survey.

SUBJECT.

SLK.
17/10/62.



© 2020

Lloyd's Register
Foundation

003467-003473-0024