

## REPORT OF SURVEY FOR REPAIRS, &amp;c.

Date of writing Report... 5 May 1952 When handed in at Local Office... 5 May 1952 Port of Antwerp

No. in Reg. Book. 77926 Survey held at Puvelmonde Date, First Survey 23 February Last Survey 1 April 1952

on the Wood, Iron or Steel *Tw Se* "STIENTJE MENSINGA" (No. of Visits... 10)Tonnage: Built at By whom When *Canworkd '49*GROSS 499 Owners *A.L. Costerhuis* Owners' AddressUNDER DK 340 Managers *N.V. Scheepw-bedr Gruno* Port belonging to *Delfzijl*NET 201 Name of Dock *Aurichmonde Shipway* Destined VoyageSurveyed Afloat or in Dry Dock? *Both* Name of Dock *Riverside*

Cell DBor DBa feet: uE &amp; B feet: f feet: f Particulars of Classification (which must be inserted precisely as in Register Book &amp; Supplements)

total capacity tons. FPT tons; APT tons; MT feet tons. CHARACTER. \* for Special Survey. Date of last Survey and of Periodical Surveys. Machinery and Boiler Surveys (Including date of N.E., if any).

All alterations in the existing records should be underlined. Report, No. 381 Port *Rou*

Surveys, when held, must be reported in detail and serially in the terms of the Rules and Items remaining to complete

ys should be summarised. State clearly the cause of Repairs, if any, and, in detail, the nature and extent of Examinations

sequent repairs. Repairs on account of Damage (the cause of which must be stated) should be separated from Repairs due to

uses; and besides being detailed in the body of the report, should be summarised in the form shown below. Whenever the

at of Anchors or Chains is reported the particulars should be clearly stated in the space provided on the back of this form.

the dates and initials of any letters respecting this case.

cases where the Surveyor has not made a special damage report he is required to state whether he

ed his services for this purpose and to whom and why they were declined Society's Freeboard (if assigned) as painted on Ship and now verified

Offered but not required. Was a damage report made by anyone else? if so, by whom? *The Shipwrights Surveyor*

OR EXAMINATION AS PER RULE, FOR DAMAGE, DOCKING, ALTERATION AND ANNUAL SURVEY

re stated to be due to contact of Vessel's stem with 3 lighters, on the 23 February 1952, whilst

working in the Asia dock (Antwerp)

ne for damage: Vessel on Slipway: Stem nose plating cropped from waterline to landing

calisheet and part renewed. P.S. N°1 plate maincheer cropped and part renewed. N°2

ced faired and refitted. N°3 faired in place. First stake below maincheer N°1, 2 and

red in place. Frames N°4, 5 and 6 in space above forepeak cropped and part renewed,

ams + framelines in way faired in place. On completion fore peak tested, and repairs above

tested and found tight.

ig: Both Vessel on slipway: bottom and rudders cleaned, examined and recoated.

hat repairs: Center rudders stock removed and machined, bushes renewed.

OF DAMAGE REPAIRS: Shell Plates. Frames. R. Frames. Floors and Bracket Floors. Beams. Inner Bottom Plates. Dk. Plates. Other Items:—

ed ... 1 (Part) 3 — — — — Stem nose plate part renewed.

red and Faired or Repaired 1 — — — — 3 framelines faired in place.

or Repaired in place 4 — — — — 3

CONDITION OF THE

Bulkheads ☒ Engine Room Skylights *Good*Ceiling ☒ Coal Bunkers, Openings, Covers, &c. ☒Cement or Asphalt ☒ Oil Bunkers ☒Rudders *Good* Scuppers *Good*Steering gear and its connections *Good* Cargo Hatchways *Good*Windlass *Good* Hatches *Good*Have pumps been examined and found efficient? *No* PlankingHave Sluice Valves been examined and found efficient? ☒ CaulkingHave Watertight Doors been examined and found efficient? ☒ TreennalsHave Ventilators and their Coamings been examined and found efficient? *Yes* Breasthooks & StemsonAir and Sounding Pipes *Good* Transoms, Pointers & CrutchesDoubling Plates under Sounding Pipes ☒ Timbers of Frame at openings

State if examined

Copper, or Y.M. (State if on Felt.)

When fitted, Month Year

Boats *Good*Masts, Yards, &c. *Good*Condition, how ascertained *From deck*

(State if wedges removed.)

Equipment letter ☒Anchors, No. of *2 B + 1 S*Cables (State if now ranged) *No*

length mean diam. (on board.)

Rule length size

Chain Locker *Not used*Hawsers & Warps *sufficient*Standing and Running Rigging *efficient*Sails ☒

Observations, Opinion as to Class, Recommendation, &amp;c.:

State clearly whether any and, if so, what alteration is suggested to be made in the existing classification and notification of the vessel in the Register Book consequent upon

survey, thus, for example:— "to remain as classed in the Register Book without fresh record of Survey," "to remain as classed and to have record of

1,38," or "to remain as classed and to have record of survey, 1,38, and the notations of as No. 1-38."

essel as now seen is in good and efficient condition, and in our opinion eligible to remain as

with fresh record of drydocking 3.52, and the notation A.S. 3.52.

Fees applied for, 15- 5- 19 52

Repair Fee (if any) £. 14000,-

Received by me, 19

TUES. 24 JUL 1952

Character Assigned 3.52 Ant, subject

Note: write Ant

A.S. 3.52

NE made - fitted 4'52

003513-003524-0128

Lloyd's Register Foundation



AX B — If this Report is copied by Conving Press, especial care must be taken that the copying paper is not so much damped as to spread the ink, or to cause it to show through to the other side.

## ANCHORS.

\* When a bower anchor is supplied it must be clearly stated whether it is a 1st, 2nd, or 3rd bower.

[illegible]