

COPY

EA
Ship's name "MULBERRY HILL"

Port

HVA No. 2137

Last survey date 27.5.64.

Class is subject to

riveting of shell plates in 'D' & 'E' strakes between frs.105/115 in way of No.2 hold (p.s) being specially examined and dealt with as necessary, and to starboard anchor and chain cable being specially examined for possible damage, next drydocking.

ACTION is DEFERRED for examination in drydock after grounding.

S.R.L. Appendix (as before or none)

Nature of present survey (afloat and in drydock)

Examination afloat after further grounding.

Recommendation

SUBJECT as above, but ACTION be DEFERRED for examination in drydock after grounding.

SUBJECT.

IN S.R.L.

Drydocking (grounding).

IN S.R.L. APPENDIX

Lower stem bar set over to port.
Bottom shell plating slightly corrugated.
Shell plates A.5 and B.1 (p.s.a) A.4 (p.s.f) and stern wrapper plate indented.
F.9, E.9 & 10 (s.s. amids) slightly wavy.

ENGR. SURS. To Note

© 2020

Lloyd's Register
Foundation

003808-003815-0164