

15 NOV 1963

Ship's name CLAN MACAULAY

Port TAKORADI

No. 159

Last survey date 10.10.63.


Class is subject to

- 1/ Propellers and fastenings being specially examined next dry docking.
- 2/ Port main engine L.P. engine being specially examined and dealt with as necessary by 10.63.

Surveyor reports the renewal of the forward centre boiler check valve studs, at which time he noted that the boiler end plate in way of the valve aperture was severely corroded and pitted. It is recommended that the forward centre boiler end plating, in way of the main check valve opening, be specially examined and dealt with as considered necessary on completion of the present voyage or by 12.63.

Repairs also effected to boiler feed piping and the Surveyor recommends that one length of feed piping, attached to the main feed check valve of the forward port boiler be renewed on completion of the present voyage or by 12.63.

It is noted that this vessel is eligible to remain as CLASSED, Subject as above and as now recommended.

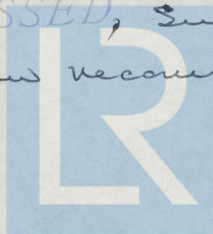

Lloyd's Register
Foundation